

Phone: 308-754-4419 308-754-5600 Fax:


Email: SaintPaul@AKRS.com

www.akrs.com

1H0S680SAH0796206



JOHN DEERE

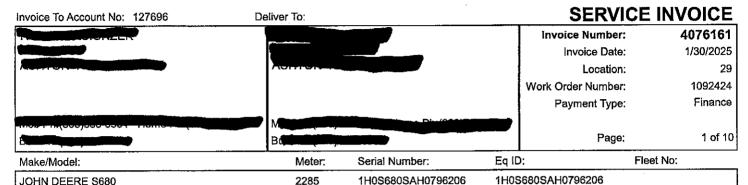

2285

/COMBINSP Retail

JOHN DEERE S680

COMPLAINT:

01 COMBINE INSPECTION

CORRECTION:

Perform Combine Inspection Per Checklist

Eng Hrs: Sep Hrs:

Part Number S3970	<u>Description</u> SERVICE L	BR DISCOUNT		Quantity -1.00	<u>List Price</u> 755.00	755.00	(\$755.00)	N Iaxed Ind
Labor: \$1,750.00	Parts: (\$755.00)	OL&M: \$0.00	Svc Acc/Env:	\$0.00	Svc Call: \$0.00	Sub	-Total:	\$995.00

Technicians: T29404

/10-900-61-F-0000090 Retail

COMPLAINT:

02 COMBINE PROMOTION WASH & DETAIL

CORRECTION:

Promotion wash& detail.

Svc Call: \$0.00 Sub-Total: \$505.00 Svc Acc/Env: \$0.00 Labor: \$505.00 Parts: \$0.00 OL&M: \$0.00

Technicians: T29414

/CLELBLT-S690 Retail

COMPLAINT:

03 CLEAN GRAIN ELEVATOR DRIVE BELT, Replace

CORRECTION:



Phone: 308-754-4419 Fax: 308-754-5600

Email: SaintPaul@AKRS.com

1H0S680SAH0796206

www.akrs.com



JOHN DEERE

Invoice To Account No: 127696	Deliver To:			SERVICE	INVOICE
THE PARTY OF THE P				Invoice Number:	4076161
				Invoice Date:	1/30/2025
				Location:	29
			V	Vork Order Number:	1092424
				Payment Type:	Finance
(100)	med Transport				
	Section 1. (000)			Page:	2 of 10
Make/Model:	Meter:	Serial Number:	Eq ID:	Flee	et No:

1H0S680SAH0796206

/CLELBLT-S690 Retail

JOHN DEERE S680

"Open gull wing door and remove all shields necessary Unbolt tensioner and release tension. Remove old belt and install new belt. Retension to specification and test run."

Part Number H223230	<u>Description</u> V-BELT			Quantit 1.00		Net Price 261.61	Extended Price \$261.61	Taxed Ind N
Labor: \$192.50	Parts: \$261.61	OL&M: \$0.00	Svc Acc/Env:	\$0.00	Svc Call: \$0.00	Sub	-Total:	\$454.11

Technicians: T29404

/EXMNFDGSK-S690FT4 Retail

COMPLAINT:

04 EXHAUST MANIFOLD/GASKETS FT4, Replace

CORRECTION:

Drained coolant, removed air filter housing, intake piping, debris management pipe, and engine shields to access exhaust manifold and engine area.

2285

Removed turbo interstage pipe, VGT oil supply and drain lines, coolant return and supply lines, wiring harness, and removed VGT

Removed EGR inlet and outlet pipes and fixed turbo supply line.

Could not get manifold out due to a coolant line that goes under it and goes into the head.

Had to remove all manifold studs from the head and raise manifold straight up.

#1 gasket was blown out and had significant pitting in the manifold.

Called customer and he did not want it replaced.

Installed with new study, spacers, nuts, and gaskets.

Reassembled remaining parts with new gaskets and o-rings.

Put coolant back in.

Test ran.

Part Number DZ100375	<u>Description</u> Gasket	Quantity 1.00	<u>List Price</u> 9.93	Net Price 9.93	Extended Price \$9.93	Taxed Ind N
DZ105787	Spacer	12.00	19.53	19.53	\$234.36	N
DZ114164	O-RING	2.00	16.98	16.98	\$33.96	N
DZ119955	STUD	12.00	23.57	23.57	\$282.84	N




Saint Paul NE 68873-3401

Phone: 308-754-4419 Fax: 308-754-5600



www.akrs.com

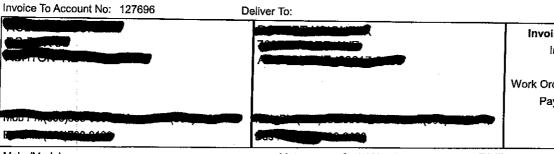

SERVICE INVOICE

roice Number: 4076161
Invoice Date: 1/30/2025
Location: 29

Work Order Number: 1092424
Payment Type: Finance

3 of 10

Page:

JOHN DEERE \$680 2285 1H0\$680\$AH0796206 1H0\$680\$AH0796206	Make/Model:	Meter.	Serial Number:	Eq ID:	Fleet No:
	JOHN DEERE \$680				

EXMNFDGSK-S690FT	4 Retail				•	
N275620	SCREW	1.00	1.14	1.14	\$1.14	N
P3750	FREIGHT	1.00	42.00	42.00	\$42.00	N
R28776	O-RING	2.00	1.86	1.86	\$3.72	N
R522023	GASKET	1.00	38.10	38.10	\$38.10	N
R526831	Gasket	3.00	12.05	12.05	\$36.15	N
R528237	SEALING RI	1.00	40.79	40.79	\$40.79	N
R528620	Gasket	2.00	61.92	61.92	\$123.84	N
R532305	O-Ring	1.00	5.32	5.32	\$5.32	N
R536559	Gasket	1.00	20.01	20.01	\$20.01	N
R539762	Flange Nut	16.00	3.55	3.55	\$56.80	N
R542509	Cap Screw	3.00	2.46	2.46	\$7.38	N
RE540355	Gasket	1.00	15.96	15.96	\$15.96	N
RE548047	Gasket	6.00	18.60	18.60	\$11 1.60	N
RE553167	GASKET	1.00	45.99	45.99	\$45.99	Ν

Labor: \$2,800:00 Parts: \$1,109.89 OL&M: \$0.00 Svc Acc/Env: \$0.00 Svc Call: \$0.00 Sub-Total: \$3,909.89

Technicians: T29404

/S670G1112575 Retail

COMPLAINT: 05 FEEDER HOUSE DRIVE BELT, R&R, LOWER, (FIXED OR W/ 5 SPEED)

CORRECTION:

Replace lower drive belt.

Adjust tension.

 
Check operation.

Part Number Quantity List Price Net Price Extended Price Taxed Ind



Saint Paul NE 68873-3401

Phone: 308-754-4419 Fax: 308-754-5600



www.akrs.com



SERVICE	INVOICE
Invoice Number:	4076161
Invoice Date:	1/30/2025
Location:	29
Work Order Number:	1092424
Payment Type:	Finance

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S680	2285	1H0S680SAH0796206	1H0S680SAH0796206	

/S670G1112575 Retail

Invoice To Account No: 127696

HXE47152

V-BELT

1.00

542.82

542.82 \$542.82

Page:

4 of 10

Labor: \$262.50

Parts: \$542.82

OL&M: \$0.00 Svc Acc/Env:

Deliver To:

\$0.00

Svc Call: \$0.00

Sub-Total:

\$805.32

Technicians: T29404

/FEEDERCHA-S690 Retail

COMPLAINT:

06 FEEDER HOUSE CONVEYOR CHAIN, SPROCKETS AND DRUM BEARINGS, Replace

CORRECTION:

Remove shields, belts and chains as necessary.

Remove feederhouse.

Roll conveyor chain to access 1/2 link.

Remove splice link and remove chain.

Remove and reinstall lower drum assembly.

Inspect all parts and replace as needed.

Remove upper shaft.

Replace bearings, collars and sprockets on upper shaft.

Reinstall upper shaft.

Reinstall lower drum.

Replace wear strips as necessary.

Install conveyor chain.

Adjust sprocket alignment and tighten hardware.

Adjust conveyor chain tightness to specs.

Reinstall feederhouse.

Reinstall drive chain and belts.

Run machine and check for leaks.

Wash off repair area.

Install shields.

Replaced upper sprockets, bearings, and FH conveyor chain.

Part Number AH220541	<u>Description</u> CHAIN LINK	Quantity 4.00	List Price 12.63	Net Price 12.63	Extended Price \$50.52	Taxed Ind N
AXE27247	ROLLER CHA	1.00	2,325.97	2,325.97	\$2,325.97	N
HXE123463	Chain Sprocket	4.00	128.17	128.17	\$512.68	N



Phone: 308-754-4419 Fax: 308-754-5600

Email: SaintPaul@AKRS.com

www.akrs.com



JOHN DEERE

4076161 1/30/2025

> 1092424 Finance

> > 5 of 10

Invoice To Account No: 127696	Deliver To:		SERVICE
			Invoice Number:
			Invoice Date:
Aloma			Location:
	,		Work Order Number:
			Payment Type:
Б О		,	Page:
Make/Model:	Meter: Seria	l Number: Ea l	D: Flee

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S680	2285	1H0S680SAH0796206	1H0S680SAH0796206	

/FEEDERCHA-S690	Retail

HXE135694	BUSHING	2.00	31.80	31.80	\$63.60	N
JD10020	BALL BEARI	1.00	49.71	49.71	\$49.71	N
JD9373	BALL BEARI	1.00	46.03	46.03	\$46.03	N

Labor: \$1,750.00 Parts: \$3,048.51 OL&M: \$0.00 Svc Acc/Env: \$0.00 Svc Call: \$0.00 Sub-Total: \$4,798.51

Technicians: T29404

/HARRTRKSNSR-S670 Retail

COMPLAINT:

07 GRAIN LOSS MONITOR CLEANING SHOE SENSOR, Replace

CORRECTION:

Disconnect wiring harness Remove sensor from finger bracket Reinstall to specifications

Check operation of monitor Separator loss monitor pad was not working. Replaced pad and noticed loom had worn into wiring. Replaced last foot of wire on pad harness. Tested sensor, it worked.

Part Number AXE55969	<u>Description</u> Sensor			Quantity 1.00	<u>List Price</u> 155.01	Net Price 155.01	Extended Price \$155.01	Taxed ind N
Labor: \$131.25	Parts: \$155.01	OL&M: \$0.00	Svc Acc/Env:	\$0.00	Svc Call: \$0.00	Şul	o-Total:	\$286.26

Technicians: T29404

/REEL PUMP-S670 Retail

COMPLAINT:

08 REEL PUMP DRIVE BEARINGS, Replace

CORRECTION:



Phone: 308-754-4419

Fax: 308-754-5600

Email: SaintPaul@AKRS.com

www.akrs.com



Invoice To Account No: 127696	Deliver To:	SERVICE	INVOICE
		Invoice Number:	4076161
4	TV.	Invoice Date:	1/30/2025
		Location:	29
		Work Order Number:	1092424
		Payment Type:	Finance
Mass Planes (coo see)	13	· · ·	
the ran (cooperation)	20,720,2400	Page:	6 of 10
P. 4 - 1 - 4 - 4 - 4 - 5 - 4 - 5 - 5 - 5 - 5 - 5	Balana Canial Mumban	Ea ID: Elo	ot No:

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S680	2285	1H0S680SAH0796206	1H0S680SAH0796206	

/REEL PUMP-S670 Retail

Release feeder house upper drive belt and remove Remove reel pump and drive assembly Remove the pump from the drive. Removed the bearings from the rive. Pack housing with grease and re-assemble Install drive on combine, re-install and adjust belt, test run

Replaced reel pump bearings. Pulley shaft was worn at small bearing. Peened and loctite upon assembly.

Part Number AH201038	<u>Description</u> BALL BEARING	Quantity 1.00	<u>List Price</u> 189.65	Net Price 189.65	Extended Price \$189.65	<u>Taxed Ind</u> N
AH201531	BRG.	1.00	59.52	59.52	\$59.52	N

Labor: \$525.00 Parts: \$249.17 OL&M: \$0.00 Svc Acc/Env: \$0.00 Svc Call: \$0.00 Sub-Total: \$774.17

Technicians: T29404

/S670G813668 Retail

COMPLAINT:

10 SERVICE INTERVAL

CORRECTION:

Change Engine Oil And Filter

Replace Air & Fuel Filters

Tighten All Belts and Chains

 
Check Fluid Levels

Took half link from tailings and clean grain elevator chains, tightened all chains.



Saint Paul NE 68873-3401

Phone: 308-754-4419 Fax: 308-754-5600



www.akrs.com



Invoice To Account No: 127696	Deliver To:	SERVIC	E INVOICE
		Invoice Number:	4076161
- CONTO		Invoice Date:	1/30/2025
		Location:	29
		Work Order Number:	1092424
		Payment Type:	Finance
		Page:	7 of 10

Make/Model:	Mete	er:	Serial Numbe	r:	Eq ID:		Fleet No:	
JOHN DEERE S680	2285	5	1H0S680SAF	0796206	1H0S680SAH0796206			
/S670G813668 Retail			•					
11M7079	COTTER PIN			2.00	0.16	0.16	\$0.32	N
80W90	BULK OIL			2.00	6.98	6.98	\$13.96	N
AXE42066	Filter Element			1.00	132.23	112.40	\$112.40	N
DZ112918	FILTER ELE			1.00	134.72	114.51	\$114.51	N
DZ130550	FILTER ELE			1.00	132.60	112.71	\$112.71	N
HXE11090	FILTER ELE			1.00	263.69	224.14	\$224.14	N
L214634	REG CAB AIR FILTER			1.00	28.61	24.32	\$24,32	N
RE572785	OIL FILTER			1.00	86.48	73.51	\$73.51	N
TA32591	AIR FILTER			1.00	71.61	71.61	\$71.61	N
TY26625Q	HY-GUARD OIL			7.00	4.19	4.19	\$29.33	N
TY26686Q	ZPLUS-50 TM ENGINE OI		•	46,00	5.60	5.60	\$257.60	N
TY6341	SD POLYUREA GREASE			1.00	7.44	7.44	\$7.44	N
Labor: \$787.50	Parts: \$1,041.85 OL&M: \$0.00		Svc Acc/Env:	\$0.00	Svc Call: \$0.00	Sub	-Total: \$1	,829.35

Technicians: T29404

/UPTLGSDRCH-S690 Retail

COMPLAINT:

11 TAILINGS AUGER DRIVE CHAIN, UPPER, Replace

CORRECTION:

Remove auger drive chain Reinstall to specifications Check operation of chain

Replaced tailing elevator drive chain, tension sprocket, and small idler sprocket.

Part NumberDescriptionQuantityList PriceNet PriceExtended PriceTaxed IndAXE23133IDLER SPRO2.0047.6947.69\$95.38N




Saint Paul NE 68873-3401

Phone: 308-754-4419 Fax: 308-754-5600

Email: SaintPaul@AKRS.com

www.akrs.com



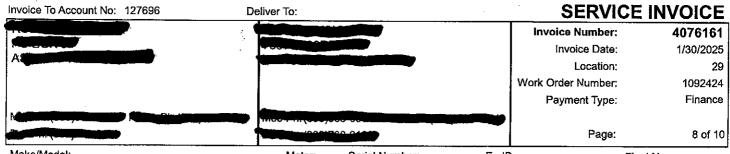

	ter: S	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S680 228	35 1	H0S680SAH0796206	1H0S680SAH0796206	

/UPTLGSDRCH-S690 Retail

AXE54619

ROLLER CHA

1.00

169.62

169.62

\$169.62

Ν

Labor: \$131.25

Parts: \$265.00

OL&M: \$0.00 Svc Acc/Env:

\$0.00

Svc Call: \$0.00

Sub-Total:

\$396.25

Technicians: T29404

Gen2 Retail COMPLAINT:

12 MISC REPAIRS

CORRECTION:

Replaced upper and lower FH drive chain guides and both idlers.

Replaced all 4 contour master pads. under side of contour master was packed full of debris, cleaned it out.

Cleaned debris from latching pins.

Installed bolt in RH separator rail that was missing.


Rotary screen tensioner was stuck, took tensioner apart and cleaned pivot bushing, reassembled.

Part Number 14M7296	Description FLANGE NUT	Quantity 1.00	List Price 1.33	Net Price 1.33	Extended Price \$1.33	Taxed Ind N
19023	SPRING	1.00	24.85	24.85	\$24.85	N
19M7815	SCREW	2.00	4.13	4.13	\$8.26	N
28H3395	BUSHING	1.00	15.97	15.97	\$15,97	N
57M10889	Elec. Connector Terminal	2.00	1.88	. 1.88	\$3.76	N
57M9547	ELEC. CONN	2.00	1.70	1.70	\$3.40	N
785305	18GA. GREEN WIRE BY FT	1.00	0.39	0.39	\$0.39	N
785902	18 GA WIRE BLACK SOLD FT	1.00	0,68	0.68	\$0.68	N
AXE19940	Idler Sprocket	2.00	49.21	49.21	\$98.42	N
H174755	BOLT	1.00	2.19	2.19	\$2.19	N
H240181	Wear Plate	1.00	86.99	86.99	\$86.99	N
H240213	Wear Plate	1.00	88.71	88.71	\$88.71	N
HXE37211	LATCH	1.00	30.67	30.67	\$30.67	N



Saint Paul NE 68873-3401

 Phone: 308-754-4419 Fax: 308-754-5600



www.akrs.com



JOHN DEERE

Invoice To Account No: 127696	Deliver To:			SERVIC	E INVOICE
	9 00			Invoice Number:	4076161
	TO TOW			Invoice Date:	1/30/2025
				Location:	29
•				Work Order Number:	1092424
				Payment Type:	Finance
Tr(only					
Pilo Div (000)	(200			Page:	9 of 10
Make/Model:	Meter:	Serial Number:	Eq ID:	F	leet No:

JOHN DEERE \$680		228	35	1H0S680SAH0796206	1H0S680SAH0796206			
Gen2 Retail HXE44825	PAD			2.00	93.64	93.64	\$187.28	N
HXE47183	GUIDE			1.00	52.14	52.14	\$52.14	N
HXE47186	GUIDE			1.00	32.26	32.26	\$32.26	N
M72598	QUICK LC	СК		10.00	2.66	2.66	\$26.60	N
TY26184	1/4" CONI	DUIT		2.00	1.23	1.23	\$2.46	N
Z34136	WASHER			1.00	7.11	7.11	\$7.11	N
Labor: \$1,006.25	Parts: \$673.47	OL&M: \$0.00	S	vc Acc/Env: \$0.00	Svc Call: \$0.00	Sub-	Total: \$1,6	79.72

Technicians: T29404

/SERVICE PROMO Retail

COMPLAINT:

13 SERVICE PROMOTION

CORRECTION:

 
5% AKRS EARLY BIRD SIGN UP PARTS DISCOUNT PROMO

Part Number Description Quantity List Price Net Price Extended Price Taxed Ind



Saint Paul NE 68873-3401

Phone: 308-754-4419 Fax: 308-754-5600



www.akrs.com



Invoice To Account No: 127696	Deliver To:			SERVICE	INVOICE
				Invoice Number:	4076161
SA SI	·			Invoice Date:	1/30/2025
Manual Ma	A			Location:	29
	•		W	ork Order Number:	1092424
		<u> </u>		Payment Type:	Finance
Name of the last o	Top I milose	,			
7,002,100				Page:	10 of 10
Make/Model:	Meter:	Serial Number:	Eq ID:	Flee	et No:

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S680	2285	1H0S680SAH0796206	1H0S680SAH0796206	

/SERVICE PROMO Retail

AKRSINS25

5% INSPECTION EARLY SIGN-UP DISC

-1.00

364.51

(\$364.51)

Labor: \$0.00

Parts: (\$364.51)

OL&M: \$0.00

Svc Acc/Env:

\$0.00

Auth. No: 619163

Svc Call: \$0.00

364.51

Sub-Total:

(\$364.51)

Technicians:

INVOICE CONTAINS \$116.74 DISCOUNT

Miscellaneous Charges:

Service Accessories

\$65.00

\$0.00

\$0.00

Finance Information

Customer PO No:

Tax Exempt No:

NE AG

*** DOCUMENT COPY ***

Type: Multi-use Acct US Merchant No: 48000375

Card No:

xxxxxxxxxxxx4876

Bill Code:

784 - JD INSPECTION - COMBINE

Credit Plan: 12077 - NP/NI Equipment Inspections

Waiver Until 11/15/25;

Labor: \$9,841.25 \$6,227.82 Parts: OL&M: \$0.00 \$65.00 Svc Acc/Enviro:

Svc Call/Hauling: Sales Tax:

> \$16,134.07 **Grand Total:**

TERMS AND CONDITIONS

This purchase(s) is subject to the terms of the Multi-Use Account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

Received by:	·•
--------------	----