


Phone: 308-452-3254 308-452-4227

Fax: Email: Ravenna@AKRS.com

www.akrs.com



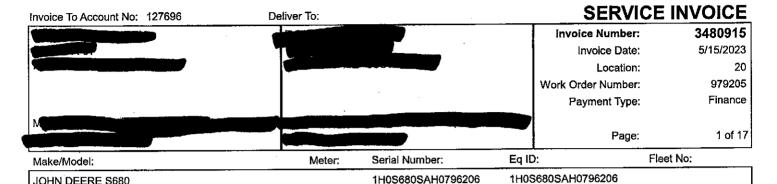

1H0S680SAH0796206

/COMBINSP Retail

JOHN DEERE S680

COMPLAINT:

01 COMBINE INSPECTION

CORRECTION:

Performed combine inspection per checklist.

Eng Hrs: 1746 hrs Sep Hrs: 1297 hrs

Part Number S3970	<u>Description</u> SERVICE L	BR DISCOUNT		Quantity -1.00	<u>List Price</u> 655.00	Net Price 655.00	Extended Price (\$655.00)	Taxed Ind N
Labor: \$1,450.00	Parts: (\$655.00)	OL&M: \$0.00	Svc Acc/Env:	\$0.00	Svc Call: \$0.00	Sub	-Total:	\$795.00

Technicians: T20406

/FLUIDSCAN Retail

COMPLAINT: 02 FLUID SCAN

CORRECTION: Oil Scan kit: Sample two oil Sample one coolant

Labor: \$0.00	Parts: \$88.83	OL&M: \$0.00	Svc Acc/Env:	\$0.00	Svc Call: \$0.00	Sul	b-Total:	\$88.83
TY26859	Scan Tes	t Kit		1.00	59.95	59.95	\$59,95	N
P3750	FREIGHT	-		1.00	12.00	12.00	\$12.00	N
Part Number IPSKIT1	<u>Description</u> Scan Tes			Quantity 1.00	<u>List Price</u> 16.88	Net Price 16.88	Extended Price \$16.88	Taxed Ind N

Technicians:




Phone: 308-452-3254

Fax: 308-452-4227 Email: Ravenna@AKRS.com

1H0S680SAH0796206

www.akrs.com



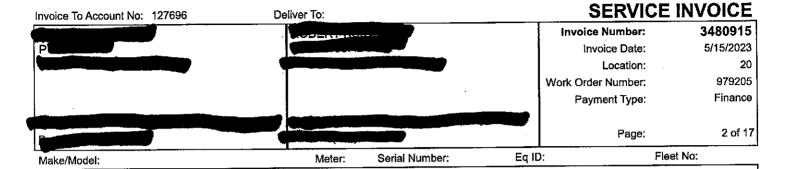

1H0S680SAH0796206

/S670H1100903 Retail

JOHN DEERE S680

COMPLAINT:

03 FEEDER HOUSE REVERSER GEAR CASE OIL, REPLACE

CORRECTION:

Drained reverser oil.

Part Number TY26408	Description 1 QT HD4		Quantity 4.00		Net Price Extended Pr 28.14 \$112.			
Labor: \$145.00	Parte: \$112.56	OL&M: \$0.00	Svc Acc/Env:	\$0.00	Svc Call: \$0.00	Sul	o-Total:	\$257.56

Technicians: T20406

Gen4 Retail

COMPLAINT:

04 REPLACE LOWER FH BELT IDLERS

CORRECTION:

Replaced 2 front FH idlers.

Part Number AH226058	PULLEY			2,00		136.37 \$272	
Labor: \$50.75	Parts: \$272.74	OL&M: \$0.00	Svc Acc/Env:	\$0.00	Svc Call: \$0.00	Sub-Total:	\$323.49

Technicians: T20406

/FHUPVARPIST-S670 Retail

COMPLAINT:

05 FEEDER HOUSE UPPER SHEAVE BEARINGS, REPLACE

CORRECTION:

Removed upper FH sensor bracket, sheave bracket and sheave. Cleaned out sheave.

Drove out bearings.

Replaced sheave bearings and reassembled.

Extended Price Taxed Ind




Phone: 308-452-3254 Fax: 308-452-4227

Email: Ravenna@AKRS.com

www.akrs.com



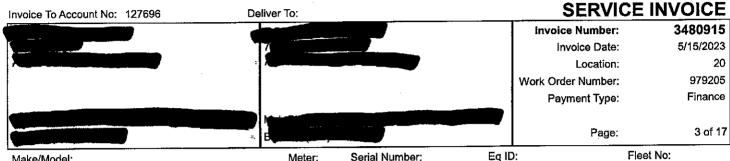

 Make/Model:
 Meter:
 Serial Number:
 Eq ID:
 Fleet No:

 JOHN DEERE \$680
 1H0\$680\$AH0796206
 1H0\$680\$AH0796206

/FHUPVARPIST-S670 Retail

 Part Number
 Description
 Quantity
 List Price
 Net Price
 Extended Price
 Taxed Ind

 JD10018
 BALL BEARI
 2.00
 35.84
 35.84
 \$71.68
 N

Labor: \$290,00 Parts: \$71,68 OL&M: \$0.00 Svc Acc/Env: \$0.00 Svc Call: \$0.00 Sub-Total: \$361.68

Technicians: T20406

Gen6 Retail

COMPLAINT:

06 REPAIR FH SLIP CLUTCH

CORRECTION:

Tightened slip clutch and replaced cotter pin.

Extended Price Quantity List Price Net Price Taxed ind Part Number Description 0.62 0.62 \$0.62 1:00 11M7032 Cotter Pin \$44.12 Svc Call: \$0.00 Sub-Total: OL&M: \$0.00 Svc Acc/Env: \$0.00 Parts: \$0.62 Labor: \$43.50

Technicians: T20406

/S670G1042046 Retail

COMPLAINT:

07 FEEDER HOUSE WEAR STRIPS, UPPER, REPLACE

CORRECTION:

Replaced 4 wear strips.

Extended Price List Price Net Price Taxed ind Description Quantity Part Number \$89.12 STRIP 4.00 22.28 22.28 H171960 \$379.12 Sub-Total: **OL&M: \$0.00** Svc Acc/Env: \$0.00 Svc Call: \$0.00 Labor: \$290.00 Parts: \$89.12

Technicians: T20406




Fax: 308-452-4227

Email: Ravenna@AKRS.com

www.akrs.com



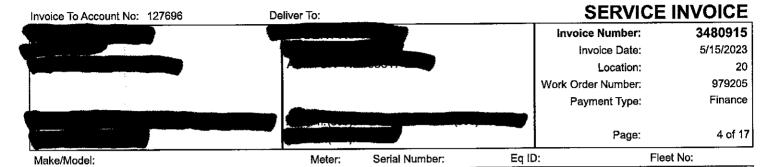

/UNLDRVBLTS-S690 Retail

COMPLAINT:

JOHN DEERE \$680

08 UNLOADING AUGER DRIVE BELTS, Replace

CORRECTION:

Removed auxiliary oil pump, belt guides and belt. Replaced unloading drive belts and reassembled.

Part Number	
AH233198	:

Description BELT SET Quantity 1.00 List Price 176.73

1H0S680SAH0796206

Net Price Ex

Extended Price Taxed Ind \$176.73 N

Labor: \$217.50

Parts: \$176.73

OL&M: \$0.00

Svc Acc/Env:

1H0S680SAH0796206

\$0.00

Svc Call: \$0.00

Sub-Total:

\$394.23

Technicians: T20406

/S670G872012 Retail

COMPLAINT:

09 CLEAN GRAIN LOWER FRONT CROSS AUGER BEARING, R&R OR REPLACE

CORRECTION:

Removed front LH drive sprocket and bearing.

Cleaned up shaft.

Replaced bearing and reassembled.

Part Number JD39104 Description BALL BEARI Quantity 1.00 List Price 42.38 Net Price 42.38 Extended Price Taxed Ind \$42.38 N

Labor: \$188.50

Parts: \$42.38

OL&M: \$0.00

Svc Acc/Env:

\$0.00

Svc Call: \$0.00

Sub-Total:

\$230.88

Technicians: T20406

Gen10 Retail

COMPLAINT:

10 REPLACE LOWER CHOPPER BELT IDLERS




Ravenna NE 68869-3199 Phone: 308-452-3254

Fax: 308-452-4227

Email: Ravenna@AKRS.com

www.akrs.com



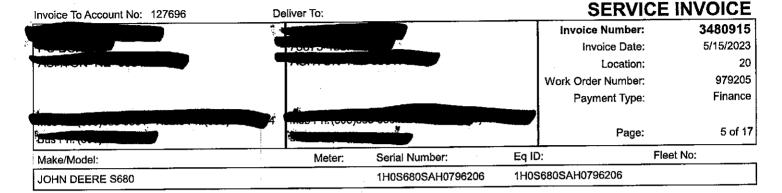

Gen10 Retail

Removed 2 lower idlers. Replaced inner idler.

Part Number AH204389	<u>Description</u> Idler			Quantity 2.00	List Price 98.10	Net Price 98.10	Extended Price \$196.20	<u>Taxed Ind</u> N
Labor: \$72.50	Parts: \$196.20	OL&M: \$0.00	Svc Acc/Env:	\$0.00	Svc Call: \$0.00	Sub	o-Total:	\$268.70

Technicians: T20406

/PITMANBRG-S680 Retail

COMPLAINT:

11 PITMAN ARM BEARINGS, Replace

CORRECTION:

Removed pitman arm assemblies and disassembled. Pressed on 4 new bearings.
Reassembled pitman arm assemblies.
Checked counter shaft bearings. Were good.
Installed pitman arms on machine.

Part Number AH125975	<u>Description</u> BALL BEA	RI		Quantity 4.00	<u>List Price</u> 97.95	<u>Net Price</u> 97.95	Extended Price \$391.80	
Labor: \$652.50	Parts: \$391,80	OL&M: \$0.00	Svc Acc/Env:	\$0.00	Svc Call: \$0.00	Sul	o-Total:	\$1,044.30

Technicians: T20406

/S670STS104644 Retail

COMPLAINT:

12 ENGINE OIL & FILTER, CHANGE REPLACE AIR FILTERS REPLACE FUEL FILTERS REPLACE HYDRAULIC FILTERS




Phone: 308-452-3254 Fax: 308-452-4227

Email: Ravenna@AKRS.com

1H0S680SAH0796206

www.akrs.com



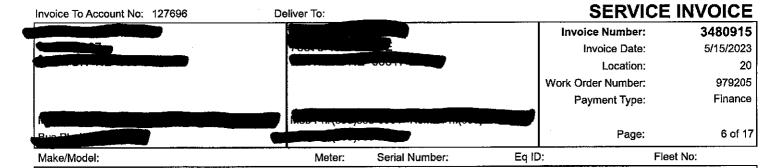

1H0S680SAH0796206

/S670STS104644 Retail

JOHN DEERE S680

Replaced engine oil and filter. Added 40 qts 15w-40. Replaced all air filters.

Replaced hydraulic filters and fuel filters.

Labor: \$362.50	Parts: \$1,330.15 OL&M: \$0.00	Svc Acc/Env: \$0	0.00	Svc Call: \$0.00	Sul	b-Total: \$	1,692.65
TY26686Q	PLUS 50 II QUARTS	-	40.00	5.14	5.14	\$205.60	N
RE572785	OIL FILTER		1.00	81.59	69.35	\$69.35	N
RE539465	FILTER ELE		1.00	101.12	85.95	\$85.95	N
RE284091	REG CAB AIR FILTER		1.00	69.52	61.55	\$61.55	N
L214634	REG CAB AIR FILTER		1.00	26.01	22.11	\$22.11	N
HXE11091	FILTER ELE		1.00	175.53	149.20	\$149.20	N
HXE11090	FILTER ELE		1.00	248.77	211.45	\$211.45	N
DZ112918	FILTER ELE		1.00	127.09	108.03	\$108.03	N
AXE42066	FILTER ELE		1.00	130.92	111.28	\$111.28	N
AXE42065	FILTER ELE		1.00	79.66	67.71	\$67.71	N
AXE12964	HYDRAULIC		1.00	95.62	81.28	\$81.28	N
AN207368	HYDRAULIC		1.00	104.97	89.22	\$89.22	N
Part Number AH128449	<u>Description</u> HYDRAULIC		Quantity 1.00	<u>List Price</u> 79.32	Net Price 67.42	Extended Price \$67.42	Taxed Ind N

Technicians: T20406

GEN13 Retail

COMPLAINT:

13 REPLACE ALL REAR AXLE HARDWARE




Fax: 308-452-4227

Email: Ravenna@AKRS.com

www.akrs.com



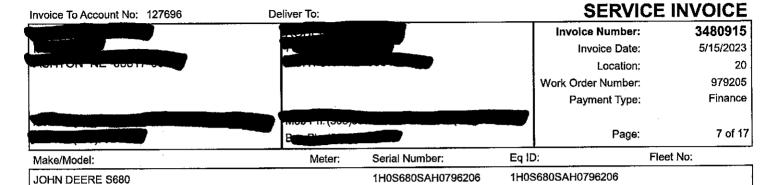

GEN13 Retail

Supported RH rear axle extension.
Removed all hardware, 3 screws were broken.
Replaced screws and nuts.
Supported LH axle extension.
Removed hardware.
Replaced hardware.

Labor: \$181.25	Parts: \$214.28	OL&M: \$0.00	Svc Acc/Env:	\$0.00	Svc Call: \$0.00	Sul	o-Total:	\$395.53
H121472	SCREW			4.00	18.17	18.17	\$72.68	N
19M7921	CAP SCRI	EW		7.00	14.70	14.70	\$102.90	N
Part Number 14M7300	<u>Description</u> FLANGE N	NUT	٠.	Quantity 9.00	List Price 4.30	Net Price 4.30	Extended Price \$38.70	Taxed Ind N

Technicians: T20406

GEN14 Retail

COMPLAINT:

14 REPLACE FEED FLOOR HARDWARE

CORRECTION:

Replaced worn hardware.

<u>Part Number</u> H174755	<u>Description</u> BOLT			Quantity 2.00	<u>List Price</u> 2.06	Net Price 2.06	Extended Price \$4.12	<u>Taxed Ind</u> N
Labor: \$50.75	Parts: \$4.12	OL&M: \$0.00	Svc Acc/Env:	\$0.00	Svc Call: \$0.00	Sub	-Total:	\$54.87

Technicians: T20406

/S660F1112876 Retail

COMPLAINT:

15 HORIZONTAL UNLOADING AUGER, REFLIGHT OUTER AUGER




Fax: 308-452-4227

Email: Ravenna@AKRS.com

1H0S680SAH0796206

www.akrs.com



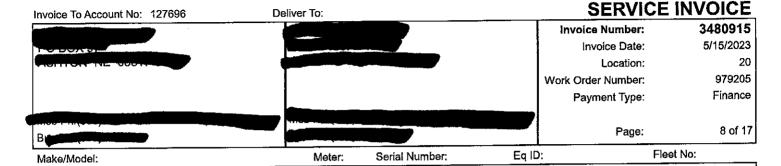

1H0S680SAH0796206

/S660F1112876 Retail

JOHN DEERE S680

Removed boot, dribble door and outer horizontal auger. Removed all horizontal augers. Installed and timed horizontal augers. Installed dribble door and boot.

OL&M Charges:

Description REFLIGHT UNLOADING AUGER

Value \$2083.61

Labor: \$435.00 Parts: \$0.00 OL&M: \$2,083.61 Svc Acc/Env: \$0.00 Svc Call: \$0.00 Sub-Total: \$2,518.61

Technicians: T20406

/CHPRBRG S600 Retail

COMPLAINT:

16 STRAW CHOPPER ROTOR BEARINGS, Replace

CORRECTION:

Removed chopper gearbox.
Removed RH bearing.
Replaced RH bearing.
Removed and replaced LH bearing.
Reinstalled gearbox.

Labor: \$435.00	Parts: \$237.34	OL&M: \$0.00	Svc Acc/Env:	\$0.00	Svc Call:	\$0.00	Şut	o-Total:	\$672.34	
Part Number AXE12177	<u>Description</u> BEARING			<u>Quanti</u> 2.0			Net Price 118.67	Extended Price \$237.34	Taxed Ind N	

Technicians: T20406

/CGLA-S680 Retail

COMPLAINT:

17 CLEAN GRAIN LOADING AUGER, Replace



Ravenna NE 68869-3199


Phone: 308-452-3254 Fax: 308-452-4227

Email: Ravenna@AKRS.com

1H0S680SAH0796206

www.akrs.com



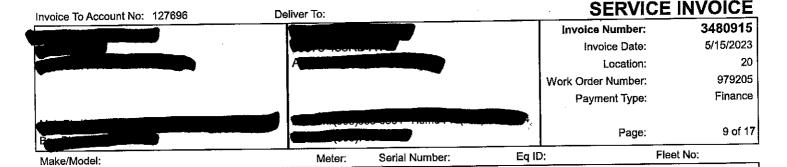

1H0S680SAH0796206

/CGLA-S680 Retail

JOHN DEERE \$680

Folded loading tube down.
Removed auger for reflight.
Installed auger.
Adjusted loading tube.
Customer will replace loading tube next year.

OL&M Charges:

Description
REFLIGHT LOADING AUGER

<u>Value</u> \$569.14

Labor: \$145.00 Parts: \$0.00 OL&M: \$569.14 Svc Acc/Env: \$0.00 Svc Call: \$0.00 Sub-Total: \$714.14

Technicians: T20406

/S670G1112588 Retail

COMPLAINT:

18 FEED ACCELERATOR BELT IDLER, R&R

CORRECTION:

Removed shield and belt tensioner. Disassembled and replaced inner idler. (Slow speed)

Reassembled on machine.

List Price Net Price Extended Price Taxed Ind Part Number **Description** Quantity 90.99 1.00 90.99 \$90.99 AH150900 **IDLER** Svc Call: \$0.00 Sub-Total: \$163.49 Svc Acc/Env: \$0.00 OL&M: \$0.00 Labor: \$72.50 Parts: \$90.99

Technicians: T20406

/S670G1112624 Retail

COMPLAINT:

19 JACKSHAFT BELT SET, FRONT, R&R PRIMARY

CORRECTION:

Replaced rear jackshaft drive belt.




Phone: 308-452-3254 Fax: 308-452-4227

Email: Ravenna@AKRS.com

www.akrs.com



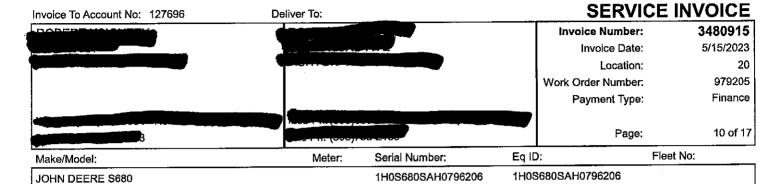

/S670G1112624 Retail

Part Number H154723	<u>Description</u> V-BELT			Quantity 1.00	<u>List Price</u> 105.21	Net Price 105.21	Extended Price \$105.21	Taxed Ind N
Labor; \$217.50	Parts: \$105.21	OL&M: \$0.00	Svc Acc/Env:	\$0.00	Svc Call: \$0.00	Sul	-Total:	\$322.71

Technicians: T20406

/S670G1112789 Retail

COMPLAINT:

20 DISCHARGE BEATER BEARINGS, R&R BOTH

CORRECTION:

Removed RH speed sensor and bearing.
Removed belt, shield and drive pulley.
Pulled up hub and cleaned up shaft.
Supported beater and removed LH bearing.
Cleaned up and reassembled with new bearing.

Labor: \$507.50	Parts: \$120.75	OL&M: \$0.00	Svc Acc/Env:	\$0.00	Svc Call: \$0.00	Sul	o-Total:	\$628.25
JD9339	BALL BEA	ARI		2.00	60.21	60.21	\$120.42	N
<u>Part Number</u> 14M7264	<u>Description</u> Lock Nut			Quantity 1.00	<u>List Prīce</u> 0.33	Net Price 0.33	Extended Price \$0.33	<u>Taxed Ind</u> N

Technicians: T20406

/DCBTRSTPS S680 Retail

COMPLAINT:

21 DISCHARGE BEATER SUPPORTS AND STRIPS, Replace

CORRECTION:

Removed beater grate.

Removed retainer and damaged pins. Reinstalled beater grate and shields.




Ravenna NE 68869-3199

Phone: 308-452-3254 Fax: 308-452-4227

Email: Ravenna@AKRS.com

www.akrs.com



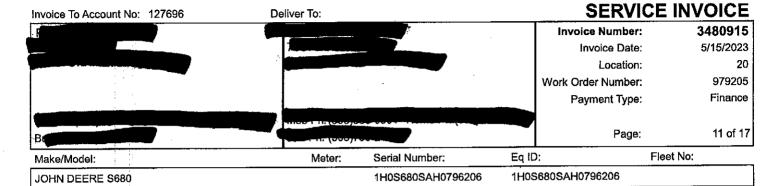

/DCBTRSTPS S680 Retail

Part Number H229469	<u>Description</u> NAIL			Quantity 7.00	<u>List Price</u> 7.95	Net Price 7.95	Extended Price \$55.65	Taxed Ind N
Labor: \$507.50	Parts: \$55.65	OL&M: \$0.00	Svc Acc/Env:	\$0.00	Svc Call: \$0.00	Sub-	Total:	\$563.15

Technicians: T20406

GEN22 Retail

COMPLAINT:

22 WELD LINER ON CGE BOOT REPLACE CGE DOOR

CORRECTION:

Cut out liners for top and bottom boots. Fitted bottom liner to boot. Welded into place. Fitted upper liners to top boot. Welded into place. Cleaned up lower boot and painted. Replaced lower door.

Part Number AXE69121	i	<u>Description</u> Door			<u>Q</u> ı	uantity 1.00	<u>List Price</u> 450.80	Net Price 450.80	Extended Price \$450.80	Taxed ind N
STAINLESS		STAINLE	SS STEEL			1.00	26.77	26.77	\$26.77	N
Labor: \$652.50	1	Parts: \$477.57	OL&M: \$0.00	Svc Acc/Env:	\$0.00		Svc Call: \$0.00	Sul	o-Total: \$	1,130.07

Technicians: T20406

/UPCGBRG&SPKT-S690 Retail

COMPLAINT:

23 CLEAN GRAIN ELEVATOR UPPER SPROCKET, Replace REPLACE LOWER CGE SPROCKET REPLACE CGE CONVEYOR CHAIN




Phone: 308-452-3254

Fax: 308-452-4227 Email: Ravenna@AKRS.com

www.akrs.com



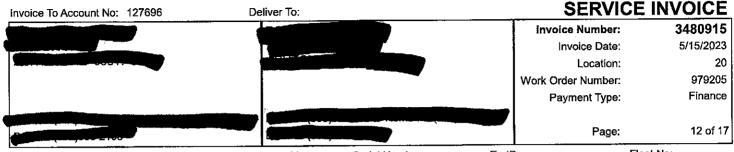

 Make/Model:
 Meter:
 Serial Number:
 Eq ID:
 Fleet No:

 JOHN DEERE \$680
 1H0\$680\$AH0796206
 1H0\$680\$AH0796206

/UPCGBRG&SPKT-S690 Retail

CORRECTION:

Removed clean grain conveyor chain, upper shaft and lower auger.

Found upper shaft key way cracked.

Replaced upper shaft, sprocket, key and bearings.

Replaced conveyor chain.

Reinstalled lower clean grain auger.

Replaced lower sprocket, key and door.

Part Number 49M6480	Description SHAFT KEY	Quantity 2.00	<u>List Price</u> 3.22	Net Price 3.22	Extended Price \$6.44	Taxed Ind N
AXE72667	Roller Chain	1.00	699.82	699.82	\$699.82	N
H220121	SHAFT	1.00	125.52	125.52	\$125.52	N
H228383	CHAIN SPRO	1.00	59.20	59.20	\$59.20	N
H228385	Chain Sprocket	1.00	63.89	63.89	\$63.89	N
JD39102	BALL BEAR!	2.00	21.84	21.84	\$43.68	N
JD39104	BALL BEARI	2.00	42.38	42.38	\$84.76	N

Labor: \$674.25 Parts: \$1,083.31 OL&M: \$0.00 Svc Acc/Env: \$0.00 Svc Call: \$0.00 Sub-Total: \$1,757.56

Technicians: T20406

/CLELBLT-S690 Retail

COMPLAINT:

24 CLEAN GRAIN ELEVATOR DRIVE BELT, Replace

CORRECTION:

Removed shields and loading tube. Removed clean grain elevator drive belt.

Replaced belt and reassembled.

Part Number Quantity List Price Net Price Extended Price Taxed Ind




Ravenna NE 68869-3199 Phone: 308-452-3254

308-452-4227 Fax:

Email: Ravenna@AKRS.com www.akrs.com



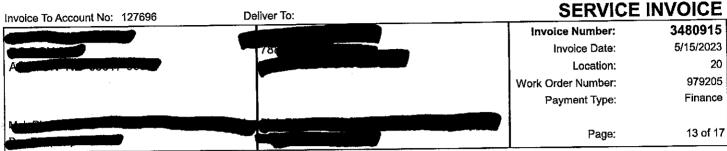

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S680		1H0S680SAH0796206	1H0S680SAH0796206	

/CLELBLT-S690 Retail

Technicians: T20406

H223230

V-BELT

1.00

307.79

\$307.79

Labor: \$159.50

Parts: \$307.79

OL&M: \$0.00 Svc Acc/Env:

\$0.00

Svc Call: \$0.00

307.79 Sub-Total:

\$467.29

/UPTLGSDRCH-S690 Retail

COMPLAINT:

25 RETHRESHER DRIVE CHAIN, UPPER, Replace

CORRECTION:

Removed covers and rethresher chain. R

epiac	ed cha	ain and	i reassemb	led.

Labor: \$72.50	Parts: \$169.62	OL&M: \$0.00	Svc Acc/Env:	\$0.00	Svc Call: \$0.00	Sul	o-Total:	\$242.12
Part Number AXE54619	<u>Description</u> ROLLER (CHA ·		Quantity 1.00	169.62	169.62	\$169.62	N

Technicians: T20406

/S670H100304R Retail

COMPLAINT:

26 RADIATOR IMPELLER, REPLACE

CORRECTION:

Removed impeller. Supporting hub was wore. Replaced hub and reassembled.

Part Number

Description

Quantity

List Price

Net Price

Extended Price Taxed Ind




Ravenna NE 68869-3199

Phone: 308-452-3254 Fax: 308-452-4227

Email: Ravenna@AKRS.com

www.akrs.com



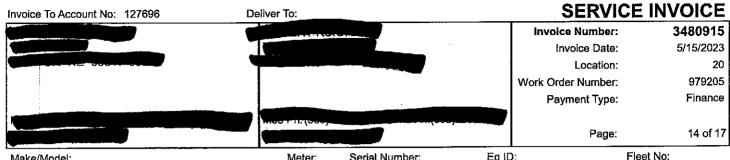

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S680		1H0S680SAH0796206	1H0S680SAH0796206	

/S670H100304R Retail

HUB HXE66282

63.46

63,46 \$63,46

Labor: \$116.00

Parts: \$63.46

OL&M: \$0.00

Svc Acc/Env:

\$0.00

1.00

Svc Call: \$0.00

Sub-Total:

\$179.46

Technicians: T20406

GEN27 Retail

COMPLAINT:

27 REPLACE ENGINE GEARCASE OIL REPLACE FINAL DRIVE OIL

CORRECTION:

Drained engine gearcase/transmission oil.

Replaced oil.

Drained oil off bottom of final drives.

Oil was clean.

Topped off both final drives.

Labor: \$290.00	Parts: \$194.12	OL&M: \$0.00	Svc Acc/Env:	\$0.00	Svc Call: \$0.00	Sub	-Total:	\$484.12
TY6296	1 QT 80W	90 GL5		1.00	10.35	9.32	\$9.32	N
<u>Part Number</u> TY26625Q	<u>Description</u> HY GARD	QUARTS		Quantity 44.00	<u>List Price</u> 4.20	Net Price 4.20	Extended Price \$184.80	Taxed Ind N

Technicians: T20406

/S670STSF813668 Retail

COMPLAINT:

28 ADJUST ALL CHAINS & BELTS, GREASE

CORRECTION:

Greased machine.

Adjusted up belts and chains.

Part Number

Description

Quantity

List Price

Net Price

Extended Price Taxed Ind




Ravenna NE 68869-3199

Phone: 308-452-3254 Fax: 308-452-4227

Email: Ravenna@AKRS.com

www.akrs.com



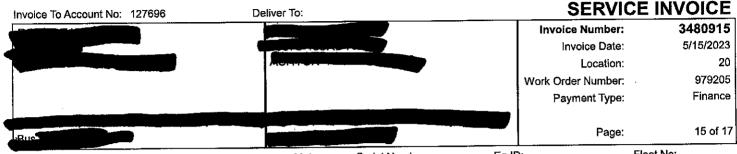

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE S680		1H0S680SAH0796206	1H0S680SAH0796206	

/S670STSF813668 Retail

AN102562 LUBRICANT 1.00 6.72 6.72 \$6.72 N TY6341 Grease 1.00 7.13 6.92 \$6.92 N

Labor: \$435.00 Parts: \$13.64 OL&M: \$0.00 Svc Acc/Env: \$0.00 Svc Call: \$0.00 Sub-Total: \$448.64

Technicians: T20406

/CHOPBELT-S690 Retail

COMPLAINT:

29 STRAW CHOPPER UPPER DRIVE BELT, Replace

CORRECTION:

Removed aux pumps, charged air clamps and guides. Removed and replaced upper chopper drive belt. Replaced tensioner cotter pin. Reassembled on machine.

Labor: \$217.50	Parts: \$513.67	OL&M: \$0.00	Svc Acc/Env:	\$0.00	Svc Call: \$0.00	Sub	o-Total:	\$731.17
HXE124868	V-BELT			1.00	513.40	513.40	\$513.40	N
<u>Part Number</u> 11M7015	<u>Description</u> Cotter Pin			Quantity 1.00	List Price 0.27	Net Price 0.27	Extended Price \$0.27	<u>Taxed ind</u> N

Technicians: T20406

GEN30 Retail

COMPLAINT:

30 REPAIR HYDRAULIC OIL LEAK UNDER FEEDERHOUSE

CORRECTION:

Feederhouse settled with stone trap open. Pinched hose.
Replaced LH lower feederhouse hose.
Topped off hydraulic oil with 2 gal hygard.




308-452-4227 Fax:

Email: Ravenna@AKRS.com

www.akrs.com



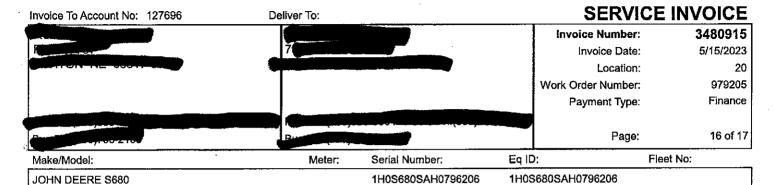

GEN30 Retail

Labor: \$130.50	Parts: \$139.98	OL&M: \$0.00	Svc Acc/Env:	0.00	Svc Call: \$0.00	Şul	o-Total:	\$270.48
TY26625Q	HY GARD	QUARTS		8.00	4.20	4.20	\$33.60	N
Part Number AXE67186	<u>Description</u> Hydraulic	Hose		Quantity 1,00	<u>List Price</u> 106.38	<u>Net Price</u> 106.38	Extended Price \$106.38	Taxed Ind N

Technicians: T20406

/FEEDBELT,FXT-S690 Retail

COMPLAINT:

31 FEEDER HOUSE DRIVE BELT, UPPER, FIXED SPEED, Replace

CORRECTION:

Took upper and lower belts loose. Removed brackets.

Replaced upper belt and reassembled.

Part Number

Description

Quantity

List Price

Net Price

Extended Price Taxed ind




Ravenna NE 68869-3199

Phone: 308-452-3254

308-452-4227

Email: Ravenna@AKRS.com www.akrs.com



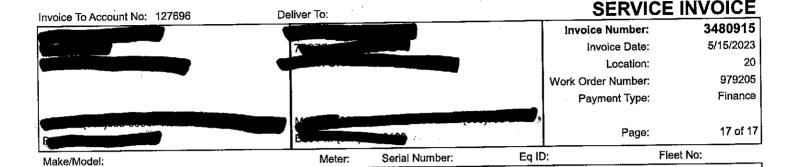

/FEEDBELT,FXT-S690 Retail

H229018

JOHN DEERE S680

V-Belt

1.00

1H0S680SAH0796206

370.97

1H0S680SAH0796206

\$370.97 370.97

Sub-Total:

N

Labor: \$290.00

Parts: \$370.97

OL&M: \$0.00

Svc Acc/Env: \$0.00

Svc Call: \$0.00

\$660.97

Technicians: T20406

INVOICE CONTAINS \$209.29 DISCOUNT

Miscellaneous Charges:

Service Accessories

\$65,00

Finance Information

Customer PO No:

Tax Exempt No:

NE AG

Type: Multi-use Acct US

Merchant No: 48000377

Card No: xxxxxxxxxxxx4876

Bill Code:

784 - JD INSPECTION -- COMBINE

Credit Plan: 12015 - DEERE AG NO PAYMENTS/NO INTEREST WAIVER UNTIL

Auth. No: 257154

Labor: Parts: OL&M: \$9,352.50 \$6,280.28 \$2,652.75

Svc Acc/Enviro: Svc Call/Hauling:

Sales Tax:

\$65,00 \$0.00 \$0.00

\$18,350,53 **Grand Total:**

**** DOCUMENT COPY * * * --

TERMS AND CONDITIONS

This purchase(s) is subject to the terms of the Multi-Use Account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.