 


Saint Paul NE 68873-3401


Phone: 308-754-4419 Fax: 308-754-5600



www.akrs.com



JOHN DEERE

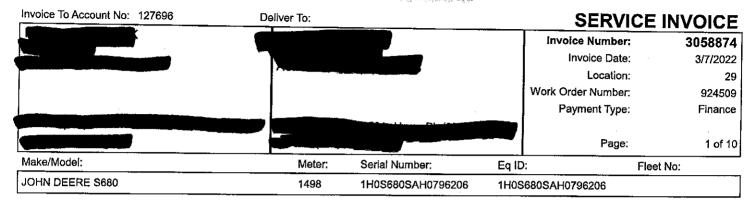

/COMBINSP Retail

COMPLAINT:

01 COMBINE INSPECTION

CORRECTION:

Performed Combine Inspection Per Checklist

Eng Hrs: 1498 Sep Hrs: 1127

BUY TWO INSPECTIONS, GET THE THIRD ON FREE

EARLY SIGN UP FOR INSPECTIONS IS NOV 1ST-JAN 15TH TO LOCK IN DISCOUNTED PRICING.

PLEASE FIND YOUR FREE GIFT FOR SIGNING UP EARLY IN YOUR COMBINE.

THANK YOU FOR YOUR BUSINESS!!!

Part Number S3970	Description SERVICE	BR DISCOUNT		<u>Quantil</u> -2.0		Net Price 304.50	Extended Price (\$609.00)	Taxed ind N
Labor: \$1,404.00	Parts: (\$609.00)	OL&M: \$0.00	Svc Acc/Env:	\$0.00	Svc Call: \$0.00	Sub-1	Total:	\$795.00

Technicians: T29404

/10-900-61-F-0000090 Retail

COMPLAINT:

02 COMBINE PROMOTION WASH & DETAIL

CORRECTION:

BLEW OFF, WASHED AND DETAILED MACHINE

 
Labor: \$405.00 Parts: \$0.00 OL&M: \$0.00 Svc Acc/Env: \$0.00 Svc Call: \$0.00 Sub-Total: \$405.00

Technicians: T29414



Saint Paul NE 68873-3401


Phone: 308-754-4419 Fax: 308-754-5600



www.akrs.com



JOHN D)EERE

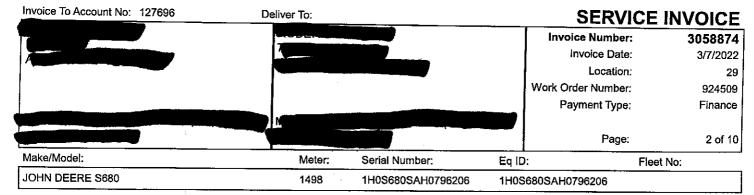

Gen1 Retail

COMPLAINT:

03 MISC REPAIRS

CORRECTION:

Had excessive noise when feederhouse was turned on. Removed upper and lower FH drive belts and spun pulleys by hand. Replaced upper belt tensioner pulley and bearings in upper drive pulley for lower FH belt. Replaced lower idler sprocket for FH drive chain. FH latching pins were hard to move and shear bolt was broke. Replaced shear bolt, Removed pins and cleaned debris from pins and holes, it still was hard to move. removed pin end of cable and tried to move it, determined that cable was bad. Replaced cable and adjusted pins. Lateral tilt bolt was broke off on LH side. Drilled bolt and used easy out to remove it. Reassembled with new bolt and bushing.

Replaced exhaust blower belt tensioner. LH clean grain bearing was loose in flanges. Replaced bearing and inner flange. Could not get outer flange, and it had no promise date, reused old flange and reassembled. Tightened clamps on hose on inside of LH duals.

Rotary screen tensioner (screen side) was stiff and did not pivot easily. Removed it and cleaned rust from pivot bushing. Reassembled and anti seized bushing. Replaced shoe auger drive belt.

<u>Part Number</u> 14M7264	Description LOCK NUT	Quantity 1.00	List Price 0.32	Net Price 0,32	Extended Price \$0,32	<u>Taxed Ind</u> N
14M7275	NUT	1.00	1.13	1.13	\$1.13	N
19M7815	SCREW	1.00	3.62	3.62	\$3.62	N
19M9326	SCREW	1.00	1.27	1.27	\$1.27	N
28H3395	BUSHING	1.00	14.94	14.94	\$14.94	N
A51212	LOCK NUT	1.00	1.51	1.51	\$1.51	N
AH212083	PUSH PULL CABLE	1.00	224.77	224.77	\$224.77	N
AH226058	Pulley	2.00	114.78	114.78	\$229.56	N
AXE19940	Idler Sprocket	1.00	40.91	40.91	\$40.91	N
AXE64513	BELT TENSI	1.00	170.95	170.95	\$170.95	N
H103264	PRESSED FL	1.00	2.42	2.42	\$2,42	N
HXE102288	V-Belt	1.00	536.03	536.03	\$536.03	N
HXE22414	CAP SCREW	1.00	2.32	2.32	\$2.32	N
JD10018	BEARING	2.00	31.61	31.61	\$63.22	N




Saint Paul NE 68873-3401

Phone: 308-754-4419 Fax: 308-754-5600



Email: SaintPaul@AKRS.com

www.akrs.com

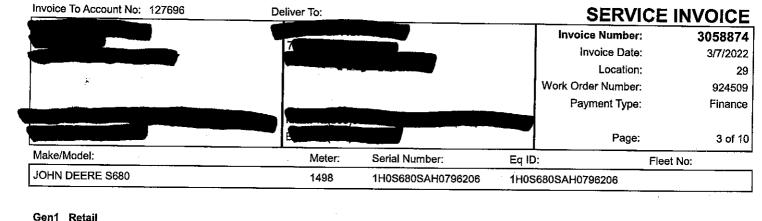

JD39102 **BALL BEARI** 1.00 21.30 21.30 \$21.30 SW60HCOUS CHAIN LINK 1.00 4.81 4.81 \$4.81 N

Labor: \$1,080.00 Parts: \$1,319.08 OL&M: \$0.00 Svc Acc/Env: \$0.00 Svc Call: \$0.00 Sub-Total: \$2,399.08

Technicians: T29404

Gen3 Retail

COMPLAINT:

04 GRAIN TANK WONT UNFOLD

CORRECTION:

Grain tank would not unfold without lifting it up. Saw it had an aftermarket bin extension on it. Checked their website and found the Installation instructions. It said if this was an issue to add an AXE17977 strut to the extension linkage. Ordered and added strut as per instructions. Tested operation, worked much faster.

Part Number AXE17977	Description GAS OPE	RAT		Quantity 1.00		Net Price 100.68	Extended Price \$100.68	<u>Taxed Ind</u> N
Labor: \$202.50	Parts: \$100.68	OL&M: \$0.00	Svc Acc/Env:	\$0.00	Svc Call: \$0.00	Sub	-Total:	\$303.18

Technicians: T29404

/CLELBLT-S690 Retail

COMPLAINT:

05 CLEAN GRAIN ELEVATOR DRIVE BELT, Replace

CORRECTION:

"Opened gull wing door and remove all shields necessary Unbolted tensioner and release tension. Removed old belt and install new belt. Retensioned to specification and test ran."

Part Number

Description

Quantity

List Price

Net Price

Extended Price Taxed Ind



Saint Paul NE 68873-3401


Phone: 308-754-4419 Fax: 308-754-5600

Email: SaintPaul@AKRS.com

www.akrs.com



JOHN DEERE

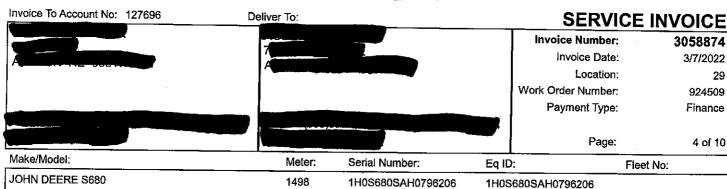

/CLELBLT-S690 Retail

H223230

V-BELT

1.00

276.68

276.68 \$276.68

Sub-Total:

Ν

Labor: \$148.50

Parts: \$276.68

OL&M: \$0.00 Svc Acc/Env: \$0.00

Svc Call: \$0.00

\$425.18

3058874

3/7/2022

924509

Finance

4 of 10

29

Technicians: T29404

/DCBTRSTPS S680 Retail

COMPLAINT:

06 DISCHARGE BEATER SUPPORTS AND STRIPS, Replace

CORRECTION:

Removed:

<DD>Shields

<DD>Drive belt

<DD>Strips

<DD>Supports and hardware. Replaced parts as necessary.

Installed in reverse order.

Test ran.

Labor: \$405.00 Parts: \$0.00 OL&M: \$0.00 Svc Acc/Env: \$0.00 Svc Call: \$0.00 Sub-Total: \$405.00

Technicians: T29404

/FDACCBRG-S670 Retail

COMPLAINT:

07 FEED ACCELERATOR BEARINGS-Replace

CORRECTION:



Saint Paul NE 68873-3401

Phone: 308-754-4419 Fax: 308-754-5600



www.akrs.com



JOHN	DEERE

Invoice To Account No: 127696	Deliver To:			SERVICE	INVOICE
	PART CONTRACTOR OF THE PARTY OF	AATTAN	Inv	oice Number:	3058874
				Invoice Date:	3/7/2022
				Location:	29
		•	Work C	Order Number:	924509
			ļ F	Payment Type:	Finance
Month Info					
				Page:	5 of 10
Make/Model:	Meter:	Serial Number:	Eq ID:	Flee	t No:
JOHN DEERE \$680	1498	1H0S680SAH0796206	1H0S680SAH	10796206	

/FDACCBRG-S670 Retail

R&R shields.

R&R feed accelerator drive belts.

R&R feed accelerator drive sheave.

Replaced feed accelerator bearings and lock collars.

Ran and checked operation.

Replaced LH feed accelerator bearing, bearing did not slide off. Removed 2 sections of feed accelerator and wet it down. Cut bearing off with torch. Made sure nothing was burning and put feed accelerator back together. Installed new bearing in housing and installed bearing.

Labor: \$438.75	Parts: \$65.29	OL&M: \$0.00	Svc Acc/Env:	\$0.00	Svc Call: \$0.00	Sul	o-Total:	\$504.04	
AXE60582	BALL BEA	ARI .		1.00	65.29	65.29	\$65.29	N	

Technicians: T29404

/FDACCBLT-S670 Retail

COMPLAINT:

08 FEED ACCELERATOR BELT, Replace

CORRECTION:

Released tension on accelerator belt, jackshaft belt and shoe supply auger belt. Removed all belts from jackshaft and installed new accelerator belt.

Reset tension on jackshaft, accelerator and shoe auger belts.

Test run.

Part Number HXE95511	<u>Description</u> V-Belt		•	Quantity 1.00	<u>List Price</u> 145.65	Net Price Extended Price 145.65 \$145.65	
Labor: \$135.00	Parts: \$145.65	OL&M: \$0.00	Svc Acc/Env:	\$0.00	Svc Call: \$0.00	Sub-Total:	\$280.65

Technicians: T29404

/FDACCWRST-S670 Retail

COMPLAINT:

09 FEED ACCELERATOR WEAR STRIPS, Replace




Saint Paul NE 68873-3401

Phone: 308-754-4419 Fax: 308-754-5600



www.akrs.com



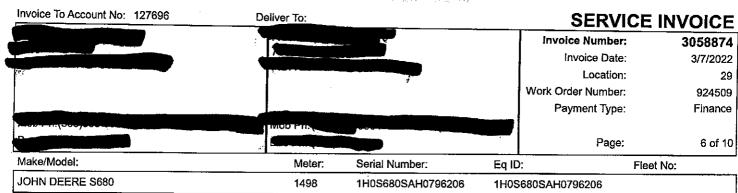

/FDACCWRST-S670 Retail

CORRECTION:

R&R both feeder house top doors. Lowered feeder house to ground. R&R or replaced wear strips with new hardware. Ran and checked operation.

Flipped all feed accelerator plates.

Labor: \$742.50	Parts: \$0.00	OL&M: \$0.00	Svc Acc/Env: \$0.00	Svc Call: \$0.00	Sub-Total:	\$742.50

Technicians: T29404

/S670H100400 Retail

COMPLAINT:

10 GRAIN LOSS MONITOR SENSOR PADS

CORRECTION:

GRAIN LOSS MONITOR PADS

- 1. Disconnected wiring harness.
- 2. Removed cap screws and sensor.
- 3. Installed new sensor and connect harness.

 
Replaced all 3 grain loss sensors, checked operation, all 3 were working

Part Number <u>Description</u> <u>Quantity</u> <u>List Price</u> <u>Extended Price</u> <u>Taxed Ind</u>




Saint Paul NE 68873-3401

Phone: 308-754-4419 308-754-5600



www.akrs.com



 

ı	Payment Type:	Finance
1		

				invoice Number:	3058874
	TA			Invoice Date:	3/7/2022
	A			Location:	29
			Wo	ork Order Number:	924509
				Payment Type:	Finance
В	:			Page:	7 of 10
Make/Model:	Meter:	Serîal Number:	Eq ID:	Fle	et No:
JOHN DEERE S680	1498	1H0S680SAH0796206	1H0S680	SAH0796206	

Deliver To:

/S670H100400 Retail

Invoice To Account No: 127696

AXE55969 Sensor 3.00 126.42 126.42 \$379.26 Labor: \$202.50 Parts: \$379.26 OL&M: \$0.00 Svc Acc/Env: \$0.00 Svc Call: \$0.00 Sub-Total: \$581.76

Technicians: T29404

/S670G813668 Retail

COMPLAINT:

11 SERVICE INTERVAL

CORRECTION:

Changed Engine Oil And Filter

Replaced Air & Fuel Filters

Tightened All Belts and Chains

Checked Fluid Levels

Topped off antifreeze. Tightened chains. Replaced cab filters and outer exhaust blower filter. Cleaned heavy duty sediment bowl and replaced the filter. Installed new outer engine air filter and both fuel filters. Changed engine oil and filter. Greased all zerks.

Part Number AXE42066	<u>Description</u> Filter Element	Quantity 1.00	List Price 101.03	Net Price 85.88	Extended Price \$85.88	Taxed Ind N
DZ112918	FILTER ELE	1.00	99.73	84.77	\$84.77	N
HXE11090	FILTER ELE	1.00	186.36	158.41	\$158.41	N
L214634	REG CAB AIR FILTER	1.00	21.48	18.26	\$18.26	N
N378886	Fuel Filter	1.00	235.56	235.56	\$235.56	N
RE284091	REG CAB AIR FILTER	1.00	59.75	50.79	\$50.79	N
RE539465	FILTER ELEMENT	1.00	85.12	72.35	\$72.35	N
RE572785	OIL FILTER	1.00	57.24	48.65	\$48.65	N




Saint Paul NE 68873-3401

Phone: 308-754-4419 Fax: 308-754-5600



Email: SaintPaul@AKRS.com www.akrs.com

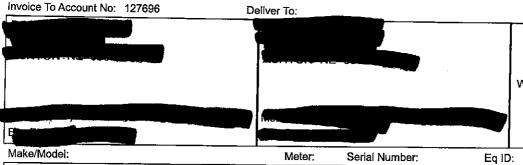

SERVICE INVOICE Invoice Number: 3058874

> Invoice Date: Location:

Work Order Number: Payment Type:

29 924509 Finance

3/7/2022

Page:

8 of 10

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE \$680	1498	1H0S680SAH0796206	1H0S680SAH0796206	

/S670G813668 Retail

TY24425 **GREASE** 1.00 4.19 4.19 \$4.19 TY26573 COOL-GARD TM 1.00 27.72 27.72 \$27.72 TY26686Q ZPLUS-50 TM ENGINE OI 45.00 3.78 3.78 \$170.10 Ν

Labor: \$607.50 Parts: \$956.68 OL&M: \$0.00 Svc Acc/Env: \$0.00 Svc Call: \$0.00 Sub-Total: \$1,564.18

Technicians: T29404

/S670STSF877664 Retail

COMPLAINT:

12 SHOE AUGER BEARINGS, ALL FRONT, R&R

CORRECTION:

Loosened and removed auger bearings and drive shaft bearings.

Reassembled.

Removed all 4 shoe augers. #3 shoe auger had bad flighting, replaced auger. Replaced front and rear bearings on augers. Reinstalled augers and set gear backlash.

Labor: \$641.25	Parts: \$516.56	OL&M: \$0.00	Svc Acc/Env:	\$0.00	Svc Call: \$0.00	Sui	o-Total: \$	1,157.81
M48583	SHAFT KI	EY		1.00	8.06	8.06	\$8.06	N
JD8554	ECCENT	RIC		4.00	6.12	6.12	\$24.48	N
AXE39453	BEARING	i		4.00	37.10	37. 10	\$148.40	N
AH163056	BEARING	HOUSING W		4.00	46.75	46.75	\$187.00	N
Part Number AH146787	Description AUGER			Quantity 1.00	<u>List Price</u> 148.62	Net Price 148.62	Extended Price \$148.62	Taxed Ind N

Technicians: T29404

 
Gen2 Retail COMPLAINT:

13 REPAIR WIRING HARNESS



Saint Paul NE 68873-3401


Phone: 308-754-4419 Fax: 308-754-5600



www.akrs.com



JOHN DEERE

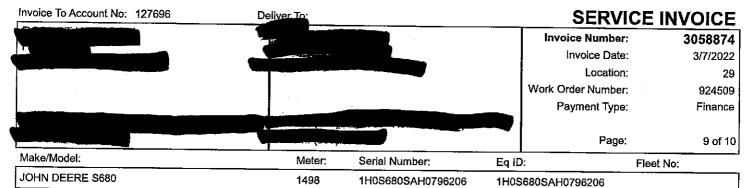

Gen2 Retail

CORRECTION:


Noticed that some wiring had been bypassed and went to several connectors. Checked old work orders and found it was to fix a LC2 3509.03 code for sensor supply voltage. Checked wiring harness over carefully and found it was rubbed through above the intermediate chopper pulley. Removed harness from there back to access the bad spot and repaired it. Reinstalled harness, cut out bypass wire. There was not enough wire to splice it back to the original wire at the connectors. Had to put new terminals on and longer pigtails to splice it in. Spliced wiring back to the factory harness at 4 connectors, tested operation.

<u>Part Number</u> 57M10488	Description Elec. Connector Terminal	Quantity 2.00	List Price 1.49	Net Price 1.49	Extended Price \$2.98	Taxed Ind N
57M10889	Elec. Connector Terminal	8.00	1.49	1.49	\$11.92	N
57M9808	Elec. Connector Terminal	5.00	1.64	1.64	\$8.20	N
785105	20 GA. GREEN WIRE	5.00	0.22	0.22	\$1.10	N
R44302	TIE BAND	27.00	0.17	0.17	\$4.59	N



Saint Paul NE 68873-3401

 Phone: 308-754-4419 308-754-5600



www.akrs.com



JOHN DEERE

Invoice To Account No: 127696 Deliver To: SERVICE INVOICE Invoice Number: 3058874 Invoice Date: 3/7/2022 Location: 29 Work Order Number: 924509 Payment Type: Finance Page: 10 of 10 Make/Model: Meter: Serial Number: Eq ID: Fleet No: JOHN DEERE \$680 1498 1H0S680SAH0796206 1H0S680SAH0796206

Gen2 Retail

TY27167

Tube

0.10

12.60

12.60

Sub-Total:

Ν

Labor: \$843,75

Parts: \$30.05

OL&M: \$0.00

Svc Acc/Env:

\$0.00

Svc Call: \$0.00

\$1.26

\$873.80

Technicians:

INVOICE CONTAINS \$91.60 DISCOUNT

Miscellaneous Charges:

Service Accessories

\$65.00

\$65.00

\$0.00

\$0.00

Finance Information

Customer PO No:

Tax Exempt No:

FORM 13

* * * DOCUMENT COPY * * *

Type: Multi-use Acct US

Merchant No: 48000375 Card No:

xxxxxxxxxxxxxx4876

Bill Code:

784 - INSPECTION - COMBINE

Credit Plan: 12006 - DEERE AG NO PAYMENTS/NO

INTEREST WAIVER UNTIL

Auth. No: 923147

Labor: Parts:

\$7,256.25 \$3,180.93 \$0.00

OL&M: Svc Acc/Enviro: Svc Call/Hauling:

Sales Tax:

\$10,502.18 **Grand Total:**

TERMS AND CONDITIONS

Repayment Terms: Customer Disclosure - This form must be signed by the customer to process the Multi-Use Account transaction. The following special terms, as described in the Multi-Use Account credit agreement, apply to the attached invoice. No Payments and No Interest until November 15, 2022. Following the deferral period, the ANNUAL PERCENTAGE RATE (APR) applicable to your Account will apply to this purchase.

This purchase(s) is subject to the terms of the Multi-Use Account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

Pacaivad h	Date	,
LACCRIVED D		