

Phone: 308-384-8777 308-398-3024 Fax:

Email: GrandIsland@AKRS.com

www.akrs.com



Invoice To Account No: 121004

Deliver To:

SERVICE INVOICE

H2 FARMS INC MARK HOLLISTER 11550 HILLTOP RD H2 FARMS INC 11550 HILLTOP RD **Invoice Number:** Invoice Date:

3623259

DONIPHAN NE 68832-2091

DONIPHAN NE 68832-2091

Location:

Payment Type:

9/21/2023 24

Work Order Number:

1017036 Finance

Bus Phone: (402)845-6520

Prv Phone: Prv Phone:

Bus Phone: (402)845-6520

Page:

1 of 5

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

MISC 1996 blue

77199

1XKNDE9X9TS720031

1XKNDE9X9TS720031G

/DOT -F-000002 Retail

COMPLAINT:

01 SEMI TRACTOR OR TRUCK ANNUAL INSPECTION

CORRECTION:

performed DOT inspection on tractor made list for customer of defects found

Labor: \$117.80

Parts: \$0.00

OL&M: \$0.00

Svc Acc/Env: \$0.00

Svc Call: \$0.00

Sub-Total:

\$117.80

Technicians: T04416

Gen2 Retail COMPLAINT:

02 The A/C is not blowing cold air; air volume is low. Diagnose and repair as needed.

CORRECTION:

tested operation of a/c compressor was not running hooked up a/c machine and recovered 1.0lb of freon pulled vac held a vac for 10min charged 3.0 lb of freon tested operation again, compressor still would not engage found broken wire on a/c compressor clutch soldered wire back together tested again

Labor: \$172.05

Parts: \$0.00

OL&M: \$0.00

Svc Acc/Env:

\$0.00

Svc Call: \$0.00

Sub-Total:

\$172.05

Technicians: T04416

Gen3 Retail

COMPLAINT:

03 Shifter leaks air. Repair as needed.



Phone: 308-384-8777 308-398-3024 Fax:

Email: GrandIsland@AKRS.com

www.akrs.com



Invoice To Account No: 121004

Deliver To:

H2 FARMS INC

SERVICE INVOICE

H2 FARMS INC MARK HOLLISTER

11550 HILLTOP RD **DONIPHAN NE 68832-2091** 11550 HILLTOP RD

DONIPHAN NE 68832-2091

Invoice Number: Invoice Date:

9/21/2023

Location: Work Order Number:

Payment Type:

24 1017036 Finance

3623259

Bus Phone: (402)845-6520

Prv Phone:

Bus Phone: (402)845-6520

Prv Phone:

Page:

2 of 5

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

MISC 1996 blue

77199

1XKNDE9X9TS720031

1XKNDE9X9TS720031G

Gen3 Retail

CORRECTION:

Removed and replaced shift knob

Filled tanks with air and tested operation, no more leaks now

Labor: \$31.00

Parts: \$0.00

OL&M: \$0.00

Svc Acc/Env: \$0.00

Svc Call: \$0.00

Sub-Total:

\$31.00

Technicians: T04416

Gen4 Retail

COMPLAINT:

04 R&R steering shocks.

CORRECTION:

Removed and replaced steer shocks

Labor: \$77.50

Parts: \$0.00

OL&M: \$0.00

Svc Acc/Env:

\$0.00

Svc Call: \$0.00

Sub-Total:

\$77.50

Technicians: T04416

Gen5 Retail

COMPLAINT:

05 R&R 4 clutch linkage ball ends.

CORRECTION:

Removed two clutch linkage rods Removed and replaced ball ends on linkage Reinstalled linkage rods Tested operation of clutch



Phone: 308-384-8777 308-398-3024 Fax:

Email: GrandIsland@AKRS.com

www.akrs.com



Invoice To Account No: 121004

Deliver To:

SERVICE INVOICE

H2 FARMS INC MARK HOLLISTER 11550 HILLTOP RD

DONIPHAN NE 68832-2091

H2 FARMS INC 11550 HILLTOP RD

DONIPHAN NE 68832-2091

Invoice Number: Invoice Date:

Location:

Work Order Number: Payment Type: 3623259 9/21/2023 24

1017036 Finance

Bus Phone: (402)845-6520

Prv Phone:

Bus Phone: (402)845-6520

Prv Phone:

Page:

3 of 5

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

MISC 1996 blue

77199

1XKNDE9X9TS720031

1XKNDE9X9TS720031GI

Gen5 Retail

Labor: \$85.25

Parts: \$0.00

OL&M: \$0.00

Svc Acc/Env: \$0.00

Svc Call: \$0.00

Sub-Total:

\$85.25

Technicians: T04416

Gen6 Retail COMPLAINT:

06 Cab light is not working. Repair as needed.

CORRECTION:

Fixed loose connection on RT clearance light on cab

Labor: \$15.50

Parts: \$0.00

OL&M: \$0.00

Svc Acc/Env:

\$0.00

Svc Call: \$0.00

Sub-Total:

\$15.50

Technicians: T04416

Gen7 Retail COMPLAINT:

07 Reverse light is not working. Repair as needed.

CORRECTION:

Removed reverse light Installed LED reverse light Installed LED pigtail harness

Tested light

Labor: \$38.75

Parts: \$0.00

OL&M: \$0.00

Svc Acc/Env:

\$0.00

Svc Call: \$0.00

Sub-Total:

\$38.75

Technicians: T04416

Gen8 Retail COMPLAINT: 08 R&R batteries.



Phone: 308-384-8777 Fax: 308-398-3024

Email: GrandIsland@AKRS.com

www.akrs.com



Invoice To Account No: 121004

Deliver To:

SERVICE INVOICE

H2 FARMS INC MARK HOLLISTER 11550 HILLTOP RD

DONIPHAN NE 68832-2091

H2 FARMS INC 11550 HILLTOP RD

DONIPHAN NE 68832-2091

Invoice Number: Invoice Date:

Location:

Work Order Number: Payment Type: 9/21/2023

3623259

1017036 Finance

Bus Phone: (402)845-6520 Prv Phone:

Bus Phone: (402)845-6520

Prv Phone:

Page:

4 of 5

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

MISC 1996 blue

77199

1XKNDE9X9TS720031

1XKNDE9X9TS720031GI

Gen8 Retail

CORRECTION:

Jump started truck to get it into the shop Charged batteries but would not hold a charge Removed and replaced batteries.

Part Number TY24546B Description

BATTERY, W CORE for: Wet Charged Battery Quantity 3.00

List Price 202.87 27.00

Net Price 202.87

27.00

Extended Price \$608.61 (\$81.00)

Taxed Ind N

N

TY24546B-CR

Parts: \$527.61

OL&M: \$0.00

Svc Acc/Env:

\$0.00

-3.00

Svc Call: \$0.00

Sub-Total:

\$682.61

Labor: \$155.00 Technicians: T04416

Gen9 Retail COMPLAINT:

09 Service truck as needed.

CORRECTION:

Drained engine oil Removed and replaced oil and fuel filters Filled with new engine oil Primed fuel system Removed and replaced engine air filter

Greased truck

Part Number TY6341

Description

SD POLYUREA GREASE

Quantity

List Price 6.81 **Net Price** 6.81

Extended Price \$6.81

Taxed Ind N

Labor: \$310.00

Parts: \$6.81

OL&M: \$0.00

Svc Acc/Env:

\$0.00

Svc Call: \$0.00

Sub-Total:

\$316.81

Technicians: T04416

Gen10 Retail

COMPLAINT:

10 Install reflectors on mud flaps and the back of the cab.



Phone: 308-384-8777 Fax: 308-398-3024

Email: GrandIsland@AKRS.com

www.akrs.com



SERVICE INVOICE

Invoice To Account No: 121004

Deliver To:

Invoice Number:

3623259

H2 FARMS INC MARK HOLLISTER

11550 HILLTOP RD **DONIPHAN NE 68832-2091** H2 FARMS INC 11550 HILLTOP RD **DONIPHAN NE 68832-2091**

Invoice Date: Location: 9/21/2023

Work Order Number:

24

Payment Type:

1017036 Finance

Bus Phone: (402)845-6520

Prv Phone:

Bus Phone: (402)845-6520

Prv Phone:

Page:

5 of 5

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

MISC 1996 blue

77199

1XKNDE9X9TS720031

1XKNDE9X9TS720031G

Gen10 Retail

CORRECTION:

Removed red and white reflective tape from back of cab Installed white reflective tape per DOT regulations Installed red white reflectors on rear mud flaps

Labor: \$131.75

Parts: \$0.00

OL&M: \$0.00

Svc Acc/Env: \$0.00

Auth. No: 652106

Svc Call: \$0.00

Sub-Total:

\$131.75

Technicians: T04416

Miscellaneous Charges:

Service Accessories

\$56.73

Finance Information

Customer PO No:

Tax Exempt No:

NE AG

* * * DOCUMENT COPY * * *

Type: Multi-use Acct US

Merchant No: 48000371

Card No:

xxxxxxxxxxxxx3316

Bill Code:

- PARTS COUNTRY PARTS/SERV 717

Credit Plan: 249

- PURCHASE

Labor: Parts:

\$1,134.60 \$534.42

OL&M: \$0.00 Svc Acc/Enviro: \$56.73

\$0.00 Svc Call/Hauling: \$0.00 Sales Tax:

> \$1,725.75 **Grand Total:**

TERMS AND CONDITIONS

Received by:	Date:



Phone: 308-384-8777 Fax: 308-398-3024

Email: GrandIsland@AKRS.com

www.akrs.com



SERVICE INVOICE

Invoice to Account No: 121004 Deliver to:			VICE INVOICE
H2 FARMS INC MARK HOLLISTER 11550 HILLTOP RD DONIPHAN NE 68832-2091	H2 FARMS INC 11550 HILLTOP RD DONIPHAN NE 68832-2091	Invoice Number: Invoice Date: Location:	3314934 10/26/2022 24
		Work Order Number: Payment Type:	967303 Finance
Bus Phone: (402)845-6520	Bus Phone: (402)845-6520		
Prv Phone:	Prv Phone:	Page:	1 of 1
Make Madel	Motor: Carial Number:	Ea ID:	Fleet No:

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
MISC 1996 blue	75292	1XKNDE9X9TS720031	1XKNDE9X9TS720031G	

DOT -F-0000010 Retail

COMPLAINT:

01) SEMI TRACTOR OR TRUCK ANNUAL INSPECTION

Left side windshield is cracked & will not pass DOT inspection until it is replaced.

Mark: 308-390-3933

CORRECTION:

Truck checked out ok after the windshield was replaced. Customer contacted glass company to have windshield replaced.

Labor: \$75.00	Parts: \$0.00	OL&M: \$0.00	Svc Acc/Env:	\$0.00	Svc Call:	\$0.00	Sub-Total:	\$75.00
Technicians: T244	407							
Miscellaneous Cha Service Accessor								\$5.00
		Finance Inform	ation				Labor:	\$75.00
Customer PO No:		Type: Multi-use	Acct US Au	th. No: 78	572		Parts:	\$0.00
Tax Exempt No:	NE AG		48000371				OL&M:	\$0.00
Tax Exempt No.	NE / CO		xxxxxxxxxxx3316			Svc Ad	c/Enviro:	\$5.00
			17 - PARTS CC	UNTRY PA	ARTS/SERV	Svc Cal	I/Hauling:	\$0.00
		Credit Plan: 24	19 - DEFAULT	CREDIT PL	.AN	S	Sales Tax:	\$0.00
* * * DOCU	IMENT COPY * * *					Gra	and Total:	\$80.00

TERMS AND CONDITIONS

Received by:	Date:
--------------	-------



Phone: 308-384-8777 Fax: 308-398-3024

Email: GrandIsland@AKRS.com

www.akrs.com



CEDIMOE INIMOLOG

Deliver 10.		3EKVI	CE INVOICE
H2 FARMS INC MARK HOLLISTER	H2 FARMS INC 11550 HILLTOP RD	Invoice Number:	3124155
11550 HILLTOP RD	DONIPHAN NE 68832-2091	Invoice Date:	5/5/2022
DONIPHAN NE 68832-2091	351411 11/414 142 00032-2091	Location:	24
		Work Order Number:	931146
		Payment Type:	Finance
Bus Phone: (402)845-6520	Bus Phone: (402)845-6520		

Prv Phone: Page:

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
MISC 1996 blue	74354	1XKNDE9X9TS720031	1XKNDE9X9TS720031G	

GEN-1 Retail

Invoice To Account No: 121004

COMPLAINT:

01) 1996 Kenworth has an engine oil leak. Isolate the source of the leak & repair it.

Doliver To

CORRECTION:

JOHN DEERE FINANCIAL 180 DAY NO INTEREST/NO PAYMENT TERMS HAVE BEEN APPLIED TO THIS INVOICE. AFTER THE DEFERRED DATE, A MINIMUM MONTHLY PAYMENT IS REQUIRED & INTEREST WILL BE APPLIED TO THE UNPAID BALANCE. THE BALANCE CAN BE PAID IN FULL AT ANYTIME PRIOR TO THE DEFERRED END DATE TO AVOID ANY INTEREST CHARGE.

AKRS EQUIPMENT HAS PAID TO DEFER THE PAYMENT & INTEREST.

THANK YOU FOR YOUR BUSINESS!

Checked the source of the oil leak. Isolated it to the gasket between the front of the engine block & the backing plate the timing gear cover bolts to. Talked with Mark & the decision to repair the leak was made. Removed the hood & bumper. Drained the engine coolant and oil. Removed the air conditioner compressor & condenser without draining the Freon. Removed the radiator. Removed the rocker arm covers, Jake brake, rocker arms and push tubes. Removed the front (timing gear) cover. Removed the fuel pump. Removed camshaft pin & cam followers. Removed the camshaft. Removed the engine oil pan, cleaned it & the mating gasket surface on the engine block. Installed a new pan gasket. Removed the water pump, air compressor and power steering pump. Removed the backing plate from the front of the engine. Cleaned gasket surfaces. Cleaned & inspected parts. Installed new gaskets & front crankshaft seal. Reassembled the engine in reverse order. Adjusted the valves and the Injectors to specs. Filled the engine with coolant. Installed a new engine oil filter & filled the engine into the safe operating level with Rotella 5 synthetic blended 15w-40 diesel oil. Bled fuel system, started the engine & checked for leaks. Rechecked the engine oil level. Ran the engine for a while & no leaks were seen. Reinstalled the hood and front bumper.

Part Number 1532	Description SIL SDI COOLANT HOSE	Quantity 1.00	List Price 55.10	Net Price 55.10	Extended Price \$55.10	Taxed Ind N
B7299	HIGH EFF. LUBE	1.00	53.01	53.01	\$53.01	N
H-151	HEATER HOSE	3.00	4.28	4.28	\$12.84	N
S3940	OUTSIDE LAB/MAT NON-TAX	1.00	145.03	145.03	\$145.03	N



Phone: 308-384-8777 Fax: 308-398-3024



www.akrs.com



\$5,624.39

Grand Total:

Invoice To Account No: 121004	Deliver To:	SERVICE	E INVOICE
H2 FARMS INC	H2 FARMS INC	Invoice Number:	3124155
MARK HOLLISTER	11550 HILLTOP RD	Invoice Date:	5/5/2022
11550 HILLTOP RD DONIPHAN NE 68832-2091	DONIPHAN NE 68832-2091	Location:	24
DONIFHAN NE 80032-2091		Work Order Number:	931146
		Payment Type:	Finance
Bus Phone: (402)845-6520	Bus Phone: (402)845-6520		
Prv Phone:	Prv Phone:	Page:	2 of 2
Make/Model:	Meter: Serial Number:	Eq ID: FI	eet No:
MISC 1996 blue	74354 1XKNDE9X9TS72003	31 1XKNDE9X9TS720031G	
Technicians: T24407	E CONTAINS \$1.24 DISCOUNT		
Miscellaneous Charges: Service Accessories			\$65.00
	Finance Information	Labor:	\$5,251.90
Customer PO No:	Type: Multi-use Acct US Auth. No:	319408 Parts:	\$307.49
Tax Exempt No: FORM 13	Merchant No: 48000371	OL&M:	\$0.00
	Card No: xxxxxxxxxxx3316	Svc Acc/Enviro:	\$65.00
	Bill Code: 717 - PARTS COUNTRY	PARTS/SERV Svc Call/Hauling:	\$0.00
* * * DOCUMENT COPY * * *	Credit Plan: 12001 - Winter/Spring Progr.	ams 180 Days Sales Tax:	\$0.00

NP/NI exp 5-31-22

TERMS AND CONDITIONS

* * * DOCUMENT COPY * * *

Received by:	Date:
--------------	-------



Phone: 308-384-8777 Fax: 308-398-3024



www.akrs.com



Invoice To Account No: 121004

Deliver To:

SERVICE INVOICE

H2 FARMS INC MARK HOLLISTER 11550 HILLTOP RD

DONIPHAN NE 68832-2091

H2 FARMS INC 11550 HILLTOP RD

DONIPHAN NE 68832-2091

Invoice Number: Invoice Date:

2911028 9/14/2021

Location: Work Order Number: 912558

Payment Type:

Finance

Bus Phone: (402)845-6520

Prv Phone:

Bus Phone: (402)845-6520

Prv Phone:

Page:

1 of 2

Make/Model: MISC 1996 blue

Serial Number:

Eq ID:

Fleet No:

Meter: 72553

1XKNDE9X9TS720031

1XKNDE9X9TS720031GI

DOT -F-0000010 Retail

COMPLAINT:

01) SEMI TRACTOR OR TRUCK ANNUAL INSPECTION

CORRECTION:

SEMI TRACTOR OR TRUCK ANNUAL INSPECTION

did the inspection and talked to Mark.

Labor: \$75.00

Parts: \$0.00

OL&M: \$0.00

Svc Acc/Env:

\$0.00

Svc Call: \$0.00

Sub-Total:

\$75.00

Technicians: T24407

Gen2 Retail

COMPLAINT:

02 WASH WHERE OIL LEAKED.

CORRECTION:

WASHED OFF TRUCK WHERE OIL HAD LEAKED.

Labor: \$122.66

Parts: \$0.00

OL&M: \$0.00

Svc Acc/Env:

\$0.00

Svc Call: \$0.00

Sub-Total:

\$122.66

Technicians: T26410

Gen3 Retail

COMPLAINT:

03 REPLACE BAD HEADLIGHT

CORRECTION:

The right side outer head light was not coming on. Removed the burned out light & installed the new light. Checked the operation of the head lights.



Phone: 308-384-8777 Fax: 308-398-3024

Email: GrandIsland@AKRS.com

www.akrs.com



Invoice To Account No: 121004 Deliver To: SERVICE INVOICE H2 FARMS INC H2 FARMS INC Invoice Number: 2911028 MARK HOLLISTER 11550 HILLTOP RD Invoice Date: 11550 HILLTOP RD 9/14/2021 **DONIPHAN NE 68832-2091** DONIPHAN NE 68832-2091 Location: 24 Work Order Number: 912558 Payment Type: Finance Bus Phone: (402)845-6520 Bus Phone: (402)845-6520 Prv Phone: Prv Phone: Page: 2 of 2 Make/Model: Meter: Serial Number: Eq ID: Fleet No: MISC 1996 blue 72553 1XKNDE9X9TS720031 1XKNDE9X9TS720031G

Gen3	Retail
Cello	Netan

Labor: \$35.10 Parts: \$0.00 OL&M: \$0.00 Svc Acc/Env: \$0.00 Svc Call: \$0.00 Sub-Total: \$35.10

Technicians: T24407

Gen4 Retail COMPLAINT:

04) FIX OIL LEAK ON POWER STEERING PUMP

CORRECTION:

The bolts that hold the power steering pump in place were loose. Tightened the bolts & started the engine. Ran the engine & the oil leak appears to have stopped.

 Labor: \$70.58
 Parts: \$0.00
 OL&M: \$0.00
 Svc Acc/Env: \$0.00
 Svc Call: \$0.00
 Sub-Total: \$70.58

 Technicians: T24407

Miscellaneous Charges: Service Accessories

\$15.17

Finance Information

Customer PO No: Tax Exempt No: FORM 13

 Type:
 Multi-use Acct US
 Auth. No:
 916185

 Merchant No:
 48000371
 Card No:
 xxxxxxxxxxxx3316

 Bill Code:
 717
 - PARTS COUNTRY PARTS/SERV

* * * DOCUMENT COPY * * *

Card No: xxxxxxxxxxx3316 Svc Acc/Enviro: \$15.17 Bill Code: 717 - PARTS COUNTRY PARTS/SERV Credit Plan: 249 - PURCHASE Sales Tax: \$0.00 Grand Total: \$318.51

Labor:

Parts:

OL&M:

\$303.34

\$0.00

\$0.00

TERMS AND CONDITIONS

Received by:	Date:
	Date:



Phone: 308-384-8777 308-398-3024 Fax:

Email: GrandIsland@AKRS.com

www.akrs.com



SERVICE INVOICE

Cloot No

Invoice To Account No: 121004

H2 FARMS INC MARK HOLLISTER 11550 HILLTOP RD

DONIPHAN NE 68832-2091

H2 FARMS INC 11550 HILLTOP RD

DONIPHAN NE 68832-2091

Invoice Number: Invoice Date: Location:

Work Order Number: Payment Type:

F- ID.

24 866392 Finance

2612538

10/31/2020

Bus Phone: 402-845-6520

Prv Phone:

Bus Phone: (402)845-6520

Prv Phone:

Deliver To:

Page:

1 of 2

Make/Model:	Weter:	Serial Number:	Eq ID.	rieet No.
MISC 1996 blue	70114	1XKNDE9X9TS720031	1XKNDE9X9TS720031G	

Gen1 Retail

COMPLAINT:

01) REPAIR DAMAGE FROM FRONT COLLISION.

INSURANCE CLAIM NUMBER:

INSURANCE CO. CONTACT INFORMATION:

CORRECTION:

JOHN DEERE FINANCIAL NO INTEREST/NO PAYMENT TERMS FOR 120 DAYS HAVE BEEN APPLIED TO THIS INVOICE. AFTER THE DEFERRED DATE, A MINIMUM MONTHLY PAYMENT IS REQUIRED & INTEREST WILL BE APPLIED TO THE UNPAID BALANCE. THE BALANCE CAN BE PAID IN FULL AT ANYTIME PRIOR TO THE DEFERRED END DATE TO AVOID ANY INTEREST CHARGE.

AKRS EQUIPMENT HAS PAID TO DEFER THE PAYMENT & INTEREST.

THANK YOU FOR YOUR BUSINESS!

MOVED THE BLUE KENWORTH TRUCK INTO THE SERVICE DEPT. DISASSEMBLED AS NEEDED TO DETERMINE THE PARTS THAT WERE NEEDED TO REPAIR DAMAGE TO THE AIR CONDITIONER CONDENSER, FAN & RADIATOR TIE ROD. REMOVED THE BENT RADIATOR SUPPORT ROD. REMOVED THE AIR TUBE BETWEEN THE TURBO AND AIR COOLER THE ONE HOSE HAD A HOLE IN IT. REMOVED THE FAN AND AC BELT'S, UNBOLTED THE FAN FROM THE CLUTCH AND THEN REMOVED THE CLUTCH SO I COULD GET THE FAN OUT. INSTALLED NEW FAN AND THEN REINSTALLED THE FAN CLUTCH AND BOLTED THE FAN TO IT. INSTALLED NEW SUPPORT ROD AND NEW HOSES ON THE AIR TUBE. REMOVED THE AC CONDENSER AND INSTALLED A NEW ONE. VACUUMED DOWN THE SYSTEM AND FILLED WITH 3 LBS OF BULK FREON. REMOVED THE GRILL AND STRAITEN IT AND PUT IT BACK IN PLACE. PARKED THE TRUCK OUT SIDE AND CALLED MARK.

<u>Part Number</u> 135200-30	Description FAN-ACS 30" 8 BLADE 2.00P	Quantity 1.00	List Price 255.00	Net Price 255.00	Extended Price \$255.00	Taxed Ind N
D1029-4491	HOSE-HUMP SGL 3"X5" SILTURBO NOMEX	1.00	66.43	66.43	\$66.43	N
K202-2421-5	ROD ASSY-TIE RADIATOR 1/2-20NFX525MM	1.00	390.66	390.66	\$390.66	N
K342-825	HOSE-CHARGE AIR	1.00	59.36	59.36	\$59.36	N
P3750	FREIGHT	1.00	140.00	140.00	\$140.00	N



Phone: 308-384-8777 Fax: 308-398-3024



www.akrs.com



Invoice To Account No: 121004 Deliver To: SERVICE INVOICE H2 FARMS INC H2 FARMS INC Invoice Number: MARK HOLLISTER 2612538 11550 HILLTOP RD Invoice Date: 11550 HILLTOP RD 10/31/2020 **DONIPHAN NE 68832-2091 DONIPHAN NE 68832-2091** Location: 24 Work Order Number: 866392 Payment Type: Finance Bus Phone: 402-845-6520 Bus Phone: (402)845-6520 Prv Phone: Prv Phone: Page: 2 of 2 Make/Model: Serial Number: Meter: Eq ID: Fleet No: MISC 1996 blue 70114 1XKNDE9X9TS720031 1XKNDE9X9TS720031G Gen1 Retail PA01250 CONDENSER 1.00 308.27 308.27 \$308.27 N Labor: \$870.68 Parts: \$1,219.72 OL&M: \$0.00 Svc Acc/Env: \$0.00 Svc Call: \$0.00 Sub-Total: \$2,090.40 Technicians: T24407 Miscellaneous Charges: Service Accessories \$43.53 Finance Information Labor: \$870.68 Customer PO No: Type: Multi-use Acct US Auth. No: 170934 Parts: \$1,219.72 Tax Exempt No: FORM 13 Merchant No: 48000371 OL&M: \$0.00 Card No: xxxxxxxxxxxx3316 Svc Acc/Enviro: \$43.53 Bill Code: 717 - PARTS COUNTRY PARTS/SERV Svc Call/Hauling: \$0.00 Credit Plan: 11456 - 120 DAYS NO PAYMENTS/NO * * * DOCUMENT COPY * * * Sales Tax: \$0.00 **INTEREST** \$2,133.93 **Grand Total:**

TERMS AND CONDITIONS

Received by:	
--------------	--



Phone: 308-384-8777 Fax: 308-398-3024



www.akrs.com



SERVICE INVOICE

Invoice To Account No: 121004

H2 FARMS INC MARK HOLLISTER 11550 HILLTOP RD

DONIPHAN NE 68832-2091

Deliver To:

H2 FARMS INC. 11550 HILLTOP RD

DONIPHAN NE 68832-2091

Invoice Number:

Invoice Date: Location:

Work Order Number: Payment Type: 2536932 8/29/2020 24

854293 Finance

Bus Phone: 402-845-6520

Prv Phone:

Bus Phone: (402)845-6520

Prv Phone:

Page:

1 of 4

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

MISC 1996 blue

69290

1XKNDE9X9TS720031

1XKNDE9X9TS720031G

DOT -F-0000010 Retail

COMPLAINT:

01) SEMI TRACTOR OR TRUCK ANNUAL INSPECTION

CORRECTION:

JOHN DEERE FINANCIAL NO INTEREST/NO PAYMENT TERMS FOR 120 DAYS HAVE BEEN APPLIED TO THIS INVOICE. AFTER THE DEFERRED DATE, A MINIMUM MONTHLY PAYMENT IS REQUIRED & INTEREST WILL BE APPLIED TO THE UNPAID BALANCE. THE BALANCE CAN BE PAID IN FULL AT ANYTIME PRIOR TO THE DEFERRED END DATE TO AVOID ANY INTEREST CHARGE.

AKRS EQUIPMENT HAS PAID TO DEFER THE PAYMENT & INTEREST.

THANK YOU FOR YOUR BUSINESS!

SEMI TRACTOR OR TRUCK ANNUAL INSPECTION

Did the inspection and talked to Mark about the repairs that are needed.

Labor: \$75.00 Parts: \$0.00 OL&M: \$0.00 Svc Acc/Env: \$0.00 Svc Call: \$0.00 Sub-Total: \$75.00

Technicians: T24407

Gen2 Retail

COMPLAINT:

02) CHECK THE AIR CONDITIONER. THE BLOWER FAN IS NOT WORKING.

CORRECTION:

CHECKED AIR CONDITIONER ELECTRICAL CIRCUIT & FOUND A FUSE HAD BLOWN BECAUSE THE COMPRESSOR CLUTCH & CLUTCH OPERATING COIL WERE BURNED & THE COIL WAS SHORTED TO GROUND. REMOVED THE CLUTCH FROM THE COMPRESSOR & INSTALLED A NEW CLUTCH. REASSEMBLED AS NEEDED. AFTER A OPERATING THE A/C FOR A SHORT TIME THE NEW CLUTCH BEARING BECAME VERY HOT & SMOKE CAME OUT OF THE CLUTCH. REMOVED THE CLUTCH ASSEMBLY & RETURNED IT TO THERMO KING FOR ANOTHER NEW CLUTCH. INSTALLED THIS CLUTCH & OPERATED THE AIR CONDITIONER FOR AN EXTENED TIME.

TESTED THE VOLTAGE GOING TO CLUTCH AND IT HAD 13.5 VOLTS WHILE THE ENGINE WAS RUNNING. ADDE ONE CAN OF R134A FREON.

Part Number

Description

Quantity

List Price

Net Price

Extended Price Taxed Ind



Phone: 308-384-8777 308-398-3024 Fax:



www.akrs.com



Invoice To Account No: 121004

Deliver To:

SERVICE INVOICE

H2 FARMS INC MARK HOLLISTER 11550 HILLTOP RD H2 FARMS INC 11550 HILLTOP RD **DONIPHAN NE 68832-2091**

Bus Phone: (402)845-6520

Meter:

Invoice Number: Invoice Date:

2536932 8/29/2020 24

DONIPHAN NE 68832-2091

Location: Work Order Number:

854293 Finance

Bus Phone: 402-845-6520

Page:

Payment Type:

2 of 4

Prv Phone: Make/Model: Prv Phone:

Serial Number: Eq ID:

Fleet No:

MISC 1996 blue	MISC 1996 blue		1XKNDE9X9T	S720031	1XKNDE9X97	S720031G		
Gen2 Retail 00062NTA-04	1/4" COU	PLING		1.00	8.11	8.11	\$8.11	Y
5144		W/2 GROOVES		1.00	125.30	125.30	\$125.30	Y
57M7146	FUSE			4.00	1.63	1.63	\$6.52	Υ
7312	R134Al Fi	reon		1.00	7.58	7.58	\$7.58	Υ
AM102482	BULB			1.00	4.64	4.64	\$4.64	Y
GOLD	SAE GR.5	i		11.00	1.72	1.72	\$18.92	Y
PFT-04A-0001	1/4" NYLC	ON TUBING		2.00	1.25	1.25	\$2.50	Υ
VS068NTA-04	BRASS FI	TTING		1.00	4.55	4.55	\$4.55	Ý
Labor: \$657.90	Parts: \$178.12	OL&M: \$0.00	Svc Acc/Env:	\$0.00	Svc Call: \$0.0	0 Sub-1	Total:	\$836.02

Technicians: T24407

Gen3 Retail COMPLAINT:

03) BROKEN AIR LINE

CORRECTION:

REMOVED A SECTION OF BROKEN AIRLINE AND INSTALLED A NEW SECTION OF LINE IN ITS PLACE. CHECKED FOR LEAKS-OK.

Labor: \$121.05 Parts: \$0.00 OL&M: \$0.00 Svc Acc/Env: \$0.00 Svc Call: \$0.00 Sub-Total: \$121.05

Technicians: T24407

Gen4 Retail COMPLAINT:


04) REPAIR CLEARANCE LIGHT.

CORRECTION:

REMOVED CLEARANCE LIGHT LENS & FOUND THE BULB WAS BURNED OUT. INSTALLED A NEW LIGHT BULB & REINSTALLED THE LENS & CHECKED THAT THE LIGHT WORKED OK.



Phone: 308-384-8777 Fax: 308-398-3024

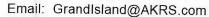

www.akrs.com



Invoice To Account No: 121004

Deliver To:

SERVICE INVOICE

H2 FARMS INC MARK HOLLISTER 11550 HILLTOP RD

DONIPHAN NE 68832-2091

Bus Phone: 402-845-6520

H2 FARMS INC 11550 HILLTOP RD

DONIPHAN NE 68832-2091

Invoice Number: Invoice Date:

2536932 8/29/2020

Location:

24

Work Order Number:

Payment Type:

854293 Finance

Bus Phone: (402)845-6520

Prv Phone:

Page:

3 of 4

Prv Phone: Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

MISC 1996 blue

69290

1XKNDE9X9TS720031

1XKNDE9X9TS720031G

Gen4 Retail

Labor: \$33.72

Parts: \$0.00

OL&M: \$0.00

Svc Acc/Env:

\$0.00

Svc Call: \$0.00

Sub-Total:

\$33.72

Technicians: T24407

Gen5 Retail

COMPLAINT:

05) REPLACE 4 AIR BAG BRACKETS ON THE LEFT SIDE.


CORRECTION:

REMOVED THE FOUR SUSPENSION AIR BAGS & BRACKETS ON LEFT SIDE OF TRUCK. INSTALLED NEW AIR BAGS AND BRACKETS. HAD TO REMOVE THE FRONT DRIVER WHEELS TO REPLACE TWO OF THE BAGS. HAD TO CUT THE BOLTS OFF THAT HELD THE BRACKETS IN PLACE.

THE FRONT DRIVE WHEELS BOLTS MUST BE RETIGHTENED AFTER 100 MILES OF OPERATION.



Phone: 308-384-8777 Fax: 308-398-3024

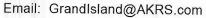

www.akrs.com



\$2,195.43

Grand Total:

SERVICE INVOICE Invoice To Account No: 121004 Deliver To: H2 FARMS INC H2 FARMS INC Invoice Number: 2536932 MARK HOLLISTER 11550 HILLTOP RD Invoice Date: 8/29/2020 11550 HILLTOP RD **DONIPHAN NE 68832-2091** DONIPHAN NE 68832-2091 Location: 24 Work Order Number: 854293 Payment Type: Finance Bus Phone: 402-845-6520 Bus Phone: (402)845-6520 Prv Phone: Prv Phone: Page: 4 of 4 Make/Model: Meter: Serial Number: Eq ID: Fleet No: MISC 1996 blue 69290 1XKNDE9X9TS720031 1XKNDE9X9TS720031GI Gen5 Retail Labor: \$911.49 Parts: \$0.00 OL&M: \$0.00 Svc Acc/Env: \$0.00 Svc Call: \$0.00 Sub-Total: \$911.49 Technicians: T24407 Miscellaneous Charges: Service Accessories \$65.00 **Finance Information** \$1,799.16 Labor: Customer PO No: Type: Multi-use Acct US Auth. No: 281926 Parts: \$178.12 Tax Exempt No: FORM 13 Merchant No: 48000371 OL&M: \$0.00 Card No: xxxxxxxxxxxx3316 \$65.00 Svc Acc/Enviro: Bill Code: 717 - PARTS COUNTRY PARTS/SERV Svc Call/Hauling: \$0.00 Credit Plan: 11456 - 120 DAYS NO PAYMENTS/NO Sales Tax: \$153.15 * * * DOCUMENT COPY * * * INTEREST

TERMS AND CONDITIONS

Received by:	Date:
,	



Phone: 308-384-8777 Fax: 308-398-3024

Email: GrandIsland@AKRS.com

www.akrs.com



SERVICE INVOICE

H2 FARMS INC MARK HOLLISTER 11550 HILLTOP RD

DONIPHAN NE 68832-2091

Bus Phone: 402-845-6520

Invoice To Account No: 121004

H2 FARMS INC 11550 HILLTOP RD

DONIPHAN NE 68832-2091

Invoice Number:

Invoice Date: 8/29/2020 Location: 24

Work Order Number: Payment Type:

854293 Finance

2536932

Bus Phone: (402)845-6520

Prv Phone:

OL&M: \$0.00

Deliver To:

Page:

1 of 4

Prv Phone: Make/Model:

Meter:

Eq ID:

Fleet No:

MISC 1996 blue

69290

1XKNDE9X9TS720031

Serial Number:

Svc Acc/Env:

\$0.00

1XKNDE9X9TS720031G

DOT -F-0000010 Retail

COMPLAINT:

01) SEMI TRACTOR OR TRUCK ANNUAL INSPECTION

CORRECTION:

JOHN DEERE FINANCIAL NO INTEREST/NO PAYMENT TERMS FOR 120 DAYS HAVE BEEN APPLIED TO THIS INVOICE. AFTER THE DEFERRED DATE, A MINIMUM MONTHLY PAYMENT IS REQUIRED & INTEREST WILL BE APPLIED TO THE UNPAID BALANCE. THE BALANCE CAN BE PAID IN FULL AT ANYTIME PRIOR TO THE DEFERRED END DATE TO AVOID ANY INTEREST CHARGE.

AKRS EQUIPMENT HAS PAID TO DEFER THE PAYMENT & INTEREST.

THANK YOU FOR YOUR BUSINESS!

SEMI TRACTOR OR TRUCK ANNUAL INSPECTION

Parts: \$0.00

Did the inspection and talked to Mark about the repairs that are needed.

Technicians: T24407

Gen2 Retail

Labor: \$75.00

COMPLAINT:

02) CHECK THE AIR CONDITIONER. THE BLOWER FAN IS NOT WORKING.

CORRECTION:

CHECKED AIR CONDITIONER ELECTRICAL CIRCUIT & FOUND A FUSE HAD BLOWN BECAUSE THE COMPRESSOR CLUTCH & CLUTCH OPERATING COIL WERE BURNED & THE COIL WAS SHORTED TO GROUND. REMOVED THE CLUTCH FROM THE COMPRESSOR & INSTALLED A NEW CLUTCH. REASSEMBLED AS NEEDED. AFTER A OPERATING THE A/C FOR A SHORT TIME THE NEW CLUTCH BEARING BECAME VERY HOT & SMOKE CAME OUT OF THE CLUTCH. REMOVED THE CLUTCH ASSEMBLY & RETURNED IT TO THERMO KING FOR ANOTHER NEW CLUTCH. INSTALLED THIS CLUTCH & OPERATED THE AIR CONDITIONER FOR AN EXTENED TIME.

TESTED THE VOLTAGE GOING TO CLUTCH AND IT HAD 13.5 VOLTS WHILE THE ENGINE WAS RUNNING. ADDE ONE CAN OF R134A FREON.

Part Number

Description

Quantity

List Price

Svc Call: \$0.00

Net Price

Extended Price Taxed Ind

Sub-Total:

\$75.00



Phone: 308-384-8777 Fax: 308-398-3024



www.akrs.com



SERVICE INVOICE

Invoice To Account No: 121004

H2 FARMS INC MARK HOLLISTER

11550 HILLTOP RD

DONIPHAN NE 68832-2091

Bus Phone: 402-845-6520

Deliver To:

H2 FARMS INC 11550 HILLTOP RD

Bus Phone: (402)845-6520

DONIPHAN NE 68832-2091

Invoice Number:

Invoice Date:

Location:

24 854293

2536932

8/29/2020

Work Order Number:

Payment Type:

Finance

Prv Phone:

Prv Phone:

Page:

2 of 4

Make/Model:		Meter:	Serial Number:	Eq ID:		Fleet No:	
MISC 1996 blue		69290	1XKNDE9X9TS720031	1XKNDE9X9T	S720031GI		
Gen2 Retail							
00062NTA-04	1/4" COUPLING		1.00	8.11	8.11	\$8.11	Y
5144	CLUTCH W/2 GF	ROOVES	1.00	125.30	125.30	\$125.30	Y
57M7146	FUSE		4.00	1.63	1.63	\$6.52	Y
7312	R134Al Freon		1.00	7.58	7.58	\$7.58	Υ
AM102482	BULB		1.00	4.64	4.64	\$4.64	Υ
GOLD	SAE GR.5		11.00	1.72	1.72	\$18.92	Υ
PFT-04A-0001	1/4" NYLON TUB	ING	2.00	1.25	1.25	\$2.50	Υ
VS068NTA-04	BRASS FITTING		1.00	4.55	4.55	\$4.55	Υ
Labor: \$657.90	Parts: \$178.12 OL	&M: \$0.00	Svc Acc/Env: \$0.00	Svc Call: \$0.00	Sub-	Total:	\$836.02

Technicians: T24407

Gen3 Retail

COMPLAINT:

03) BROKEN AIR LINE

CORRECTION:

REMOVED A SECTION OF BROKEN AIRLINE AND INSTALLED A NEW SECTION OF LINE IN ITS PLACE. CHECKED FOR

LEAKS-OK.

Labor: \$121.05

Parts: \$0.00

OL&M: \$0.00

Svc Acc/Env: \$0.00

Svc Call: \$0.00

Sub-Total:

\$121.05

Technicians: T24407

Gen4 Retail COMPLAINT:

04) REPAIR CLEARANCE LIGHT.

CORRECTION:

REMOVED CLEARANCE LIGHT LENS & FOUND THE BULB WAS BURNED OUT. INSTALLED A NEW LIGHT BULB & REINSTALLED THE LENS & CHECKED THAT THE LIGHT WORKED OK.



Phone: 308-384-8777 Fax: 308-398-3024



www.akrs.com



Invoice To Account No: 121004

H2 FARMS INC MARK HOLLISTER

11550 HILLTOP RD DONIPHAN NE 68832-2091

Bus Phone: 402-845-6520

Prv Phone:

Deliver To:

H2 FARMS INC 11550 HILLTOP RD

DONIPHAN NE 68832-2091

Invoice Number: Invoice Date:

Location:

Work Order Number:

SERVICE INVOICE 2536932

8/29/2020

24

854293 Finance

Payment Type:

3 of 4

Make/Model:

Prv Phone:

Serial Number:

Eq ID:

Fleet No:

MISC 1996 blue

Meter: 69290

Bus Phone: (402)845-6520

1XKNDE9X9TS720031

1XKNDE9X9TS720031GI

Page:

Gen4 Retail

Labor: \$33.72

Parts: \$0.00

OL&M: \$0.00

Svc Acc/Env: \$0.00

Svc Call: \$0.00

Sub-Total:

\$33.72

Technicians: T24407

Gen5 Retail

COMPLAINT:

05) REPLACE 4 AIR BAG BRACKETS ON THE LEFT SIDE.


CORRECTION:

REMOVED THE FOUR SUSPENSION AIR BAGS & BRACKETS ON LEFT SIDE OF TRUCK. INSTALLED NEW AIR BAGS AND BRACKETS. HAD TO REMOVE THE FRONT DRIVER WHEELS TO REPLACE TWO OF THE BAGS. HAD TO CUT THE BOLTS OFF THAT HELD THE BRACKETS IN PLACE.

THE FRONT DRIVE WHEELS BOLTS MUST BE RETIGHTENED AFTER 100 MILES OF OPERATION.



Phone: 308-384-8777 Fax: 308-398-3024

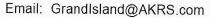

www.akrs.com




Invoice To Account No: 121004 Deliver To: SERVICE INVOICE H2 FARMS INC H2 FARMS INC Invoice Number: 2536932 MARK HOLLISTER 11550 HILLTOP RD Invoice Date: 8/29/2020 11550 HILLTOP RD **DONIPHAN NE 68832-2091 DONIPHAN NE 68832-2091** Location: 24 Work Order Number: 854293 Payment Type: Finance Bus Phone: 402-845-6520 Bus Phone: (402)845-6520 Prv Phone: Prv Phone: Page: 4 of 4 Make/Model: Meter: Serial Number: Eq ID: Fleet No: MISC 1996 blue 69290 1XKNDE9X9TS720031 1XKNDE9X9TS720031GI Gen5 Retail Labor: \$911.49 Parts: \$0.00 OL&M: \$0.00 Svc Acc/Env: \$0.00 Svc Call: \$0.00 Sub-Total: \$911.49 Technicians: T24407 Miscellaneous Charges: Service Accessories \$65.00 **Finance Information** Labor: \$1,799.16 Customer PO No: Type: Multi-use Acct US Auth. No: 281926 Parts: \$178.12 Tax Exempt No: FORM 13 Merchant No: 48000371 OL&M: \$0.00 Card No: xxxxxxxxxxxx3316 Svc Acc/Enviro: \$65.00 Bill Code: - PARTS COUNTRY PARTS/SERV 717 Svc Call/Hauling: \$0.00 Credit Plan: 11456 - 120 DAYS NO PAYMENTS/NO Sales Tax: \$153.15 * * * DOCUMENT COPY * * * **INTEREST** \$2,195.43 **Grand Total:**

TERMS AND CONDITIONS

Received by:	Date:	



Phone: 308-384-8777 Fax: 308-398-3024

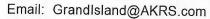

www.akrs.com



Invoice To Account No: 121004	Deliver To:		SERV	ICE INVOICE
H2 FARMS INC MARK HOLLISTER 11550 HILLTOP RD DONIPHAN NE 68832-2091	H2 FARMS INC 11550 HILLTOP RI DONIPHAN NE 6		Invoice Number: Invoice Date: Location:	1063984033020 12/11/2019 24
Bus Phone: 402-845-6520	Bus Phone: (402)84	45-6520	Work Order Number: Payment Type:	607336 Finance
Prv Phone:	Prv Phone:		Page:	1 of 1
Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
MISC 1996 blue	68900	1XKNDE9X9TS720031	1XKNDE9X9TS720031G	

Gen1 Retail

COMPLAINT:

01 SERVICE CALL- *VERIFY SERIAL NUMBER!* AFTER CHANGING FUEL FILTERS AND PURGING SYSTEM OF AIR, TRUCK WILL NOT START.

MARK: 390-3933

LOCATED: IN SW CORNER OF ALDA RD AND LEPIN RD INTERSECTION.

CORRECTION:

CHECKED THIS OUT AND HAVE DETERMINED IT IS A CONTROLLER ISSUE OR IN THE WIRE HARNESS. DO NOT H AVE A WAY TO CHECK THIS OUT FOR CODES. DID CHECK FUEL PRESSURE AND IT SEEMED TO BE OK.

Labor: \$0.00	Parts: \$0.00	OL&M: \$0.00	Svc Acc/Env:	\$202.39	Svc Call:	\$0.00	Sub-Total:	\$202.39
Technicians:								
Miscellaneous C	harges:							
service accesso	ries							\$2.00 \$4.05
		Finance Inform	ation				Labor:	\$202.39
Customer PO No:		Type: Multi-use	Acct US Aut	h. No: 413	795		Parts:	\$0.00
Tax Exempt No:	FORM 13	Merchant No:	48104007		15-70		OL&M:	\$0.00
		Card No: xx	xxxxxxxxxx3316			Svc Ac	c/Enviro:	\$6.05
		Bill Code: 70	4 - JD TRACTO	OR PARTS/S	SERVICE	Svc Call	/Hauling:	\$0.00
* * * DOC	UMENT COPY * * *	Credit Plan: 24	9 - PURCHASE			S	ales Tax:	\$0.00
HISTORICA CONTRACTOR C		4					ind Total:	\$208.44

TERMS AND CONDITIONS

Received by:	Date:
--------------	-------



Phone: 308-384-8777 Fax: 308-398-3024



www.akrs.com



Invoice To Account No: 121004

Deliver To:

SERVICE INVOICE

H2 FARMS INC MARK HOLLISTER 11550 HILLTOP RD **DONIPHAN NE 68832-2091** H2 FARMS INC 11550 HILLTOP RD **DONIPHAN NE 68832-2091**

Invoice Number: Invoice Date:

1053225033020 10/30/2019

Location:

24

Work Order Number:

604395

Bus Phone: (402)845-6520

Payment Type:

Finance

Bus Phone: 402-845-6520

Prv Phone:

Prv Phone:

Page:

1 of 2

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

MISC 1996 blue

68671

1XKNDE9X9TS720031

1XKNDE9X9TS720031G

Gen1 Retail

COMPLAINT:

01) THE AIR CONDITIONER IS NOT COOLING ADEQUATELY

CORRECTION:

JOHN DEERE FINANCIAL 120 DAYS NO INTEREST/NO PAYMENT TERMS HAVE BEEN APPLIED TO THIS INVOICE. AFTER THE DEFERRED DATE, A MINIMUM 10% MONTHLY PAYMENT IS REQUIRED & INTEREST WILL BE APPLIED TO THE UNPAID BALANCE AT. THE BALANCE CAN BE PAID IN FULL AT ANYTIME PRIOR TO THE DEFERRED END DATE TO AVOID ANY INTEREST CHARGE.

GREEN LINE EQUIPMENT HAS PAID TO DEFER THE PAYMENT & INTEREST.

THANK YOU FOR YOUR BUSINESS!

HOOKED UP GAUGES AND THERE WAS NO PRESSURE. PRESSURIZED THE A/C SYSTEM WITH 300 ISO PF DRY NITROGEN. SPRAYED SOAPY WATER ONTO ALL ACCESSIBLE FITTINGS, HOSES & LINES. THERE WAS NO VISIBLE LEAKAGE. REMOVED THE DRIVE BELT AND COMPRESSOR CLUTCH. APPLIED SOAPY WASTER TO THE COMPRESSOR & FOUND THE SEAL WAS LEAKING. BLED OF THE PRESSURE & PERFORMED STEPS TO REMOVE THE COMPRESSOR. INSTALLED A REPLACEMENT COMPRESSOR & REASSEMBLED IN REVERSE ORDER. INSTALLED A NEW RECEIVER DRYER. INSTALLED NEW BELTS. EVACUATED & CHARGED THE SYSTEM WITH 48 OZ. OF R134A FREON. THE DISCHARGE AIR INTO THE CAB WAS COLD. REASSEMBLED THE TRUCK AS NEEDED.

<u>Part Number</u> 0199	Description SINGLE JOB O-RING KIT	Quantity 1.00	List Price 5.12	Net Price 5.12	Extended Price \$5.12	Taxed Ind N
25-9540HD	BELT-A/C	1.00	51.04	51.04	\$51.04	N
5256	COMPRESSOR	1.00	358.94	358.94	\$358.94	N
7387	RECEIVER DRIER	1.00	35.01	35.01	\$35.01	N
A-A95K	V-Belt	1.00	21.13	21.13	\$21.13	N
R134AB	R134 OZ	48.00	0.60	0.60	\$28.80	N

Labor: \$0.00 Parts: \$500.04 OL&M: \$0.00 Svc Acc/Env: \$906.84 Svc Call: \$0.00 Sub-Total: \$1,406.88

Technicians:

DOT -F-0000010 Retail

COMPLAINT:



Deliver To:

4050 W Stolley Park Rd Grand Island, NE 68802

Phone: 308-384-8777 Fax: 308-398-3024



www.akrs.com



SERVICE INVOICE

			OLIVA	OF HAAOIOF
H2 FARMS INC MARK HOLLISTER 11550 HILLTOP RD	H2 FARMS INC 11550 HILLTOP RI DONIPHAN NE 6		Invoice Number: Invoice Date: Location:	1053225033020 10/30/2019
DONIPHAN NE 68832-2091				24
			Work Order Number:	604395
			Payment Type:	Finance
Bus Phone: 402-845-6520	Bus Phone: (402)84	45-6520		
Prv Phone:	Prv Phone:		Page:	2 of 2
Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
MISC 1996 blue	68671	1XKNDF9X9TS720031	1XKNDE9X9TS720031G	

DOT -F-0000010 Retail

Invoice To Account No: 121004

02) SEMI TRACTOR OR TRUCK ANNUAL INSPECTION

CORRECTION:

SEMI TRACTOR TRUCK ANNUAL INSPECTION.

INSPECTED THE TRUCK ALL INSPECTION CHECKS WERE OK.

Part Number 57M7146	<u>Description</u> FUSE			Quantity 4.00	<u>List Price</u> 1.09	Net Price 1.09	Extended Price \$4.36	<u>Taxed Ind</u> N
TY25638	BLACK S	PRAY PAINT		1.00	9.78	9.78	\$9.78	N
Labor: \$0.00	Parts: \$14.14	OL&M: \$0.00	Svc Acc/Env:	\$75.00	Svc Call: \$0.00	Suk	o-Total:	\$89.14

Technicians:

ATTENTION: Part(s) values for this invoice have changed. Original Invoice Parts Sale Value = \$544.18

Miscellaneous Charges:

epa fees

service accessories

1. Transfer in the invoice have changed. Original invoice Parts Sale Value - \$344.16

Finance Information

Customer PO No:

Tax Exempt No:

FORM 13

* * * DOCUMENT COPY * * *

Type: Multi-use Acct US Auth. No: 439853
Merchant No: 48104007

Card No: xxxxxxxxxxx3316

Bill Code: 717 - ALL MAKES PARTS/SVC

Credit Plan: 11429 - 120 DAYS NO PAYMENTS/NO

INTEREST

Labor: \$981.84
Parts: \$544.18
OL&M: \$0.00
Svc Acc/Enviro: \$32.52
Svc Call/Hauling: \$0.00
Sales Tax: \$0.00

\$2.00

\$30.52

Grand Total: \$1,558.54

TERMS AND CONDITIONS

Received by:	Date:
--------------	-------



Phone: 308-384-8777 Fax: 308-398-3024



www.akrs.com



SERVICE INVOICE

Invoice To Account No: 121004

H2 FARMS INC MARK HOLLISTER 11550 HILLTOP RD

DONIPHAN NE 68832-2091

Bus Phone: 402-845-6520

Deliver To: H2 FARMS INC

Prv Phone:

11550 HILLTOP RD

DONIPHAN NE 68832-2091

Invoice Date:

Invoice Number:

Location: Work Order Number:

Payment Type:

1042946033020

10/7/2019

24 605419

1 of 2

Finance

Page:

Prv Phone: Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

MISC 1996 blue

68733

Bus Phone: (402)845-6520

1XKNDE9X9TS720031

1XKNDE9X9TS720031G

Gen1 Retail

COMPLAINT:

01) POSSIBLE SERVICE DEPARTMENT WARRANTY: THE AIR CONDITIONER STOPPED COOLING.

ORDERED ELECTRICAL REPAIR KITS FROM SAHLING KENWORTH IN KEARNEY.

CORRECTION:

JOHN DEERE FINANCIAL 120 DAYS NO INTEREST/NO PAYMENT TERMS HAVE BEEN APPLIED TO THIS INVOICE. AFTER THE DEFERRED DATE, A MINIMUM 10% MONTHLY PAYMENT IS REQUIRED & INTEREST WILL BE APPLIED TO THE UNPAID BALANCE AT. THE BALANCE CAN BE PAID IN FULL AT ANYTIME PRIOR TO THE DEFERRED END DATE TO AVOID ANY INTEREST CHARGE.

GREEN LINE EQUIPMENT HAS PAID TO DEFER THE PAYMENT & INTEREST.

THANK YOU FOR YOUR BUSINESS!

DIAGNOSED THE CAUSE FOR THE LOSS OF COOLING TO THE MAIN FUSE PANEL IN THE CAB. FOUND THAT THE BLOWER/COMPRESSOR CLUTCH FUSE SOCKET TERMINALS HAD BEEN HOT & WERE NOT HOLDING THE FUSE TIGHTLY ENOUGH. THIS RESULTED IN HIGH RESISTANCE & THE LOSS OF VOLTAGE TO THE COMPRESSOR CLUTCH. HAD REMOVE THE FUSE PANEL FROM THE CAB AND THEN TAKE IT APART TO REPLACE THE HEAT DAMAGED FUSE HOLDER TERMINALS. ORDERED REPLACEMENT FUSE PANEL TERMINALS FROM SAHLING KENWORTH FOR THE BLOWER MOTOR AND THE A/C CLUTCH. CHECKED THE BLOWER MOTOR AND IT WAS WORKING OK. CHECKED THE COMPRESSOR CLUTCH AND FOUND IT NEEDED TO BE REPLACED. REMOVED THE CLUTCH. TOOK THE CLUTCH TO THERMO KING AND GOT A NEW COMPRESSOR CLUTCH. INSTALLED THE CLUTCH. PUT THE FUSE PANEL TOGETHER AND REINSTALLED IT. CHECKED THE AIR CONDITIONING SYSTEM & IT HAD NOT LOST THE FREON. THE AIR CONDITIONER SYSTEM WAS COOLING WELL.

Part Number

Description

Quantity


List Price

Net Price

Extended Price Taxed Ind



Phone: 308-384-8777 Fax: 308-398-3024

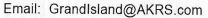

www.akrs.com



Invoice To Account No: 121004	Deliver To:			3	EKVICI	E INVOICI
H2 FARMS INC	H2 FARMS INC		Invo	ice Number:	1	04294603302
MARK HOLLISTER 11550 HILLTOP RD	11550 HILLTOP RE	11550 HILLTOP RD DONIPHAN NE 68832-2091		Invoice Date:		10/7/201
DONIPHAN NE 68832-2091	DOMITIAN NE 0	00032-2091		Location:		2
			Work O	rder Number:		60541
			Pa	ayment Type:		Financ
Bus Phone: 402-845-6520	Bus Phone: (402)84	45-6520				
Prv Phone:	Prv Phone:			Page:		2 of
Make/Model:	Meter:	Serial Number:	Eq II	D:	Fl	eet No:
MISC 1996 blue	68733	1XKNDE9X9TS72	20031 1XKI	NDE9X9TS72	0031G	
763 6" CLUT OL&M Charges:	CIT		1.00 1	43.00 1	43.00	\$143.00
OL&M Charges: Description Labor: \$0.00 Parts: \$143.00	OL&M: \$153.42	Svc Acc/Env: \$1,0		all: \$0.00	Sub-Tota	<u>V</u> alu
OL&M Charges: Description		Svc Acc/Env: \$1,0				Valu
OL&M Charges: Description Labor: \$0.00 Parts: \$143.00 Technicians: Miscellaneous Charges: epa fees						Valu al: \$1,336.0
OL&M Charges: Description Labor: \$0.00 Parts: \$143.00 Technicians: Miscellaneous Charges: epa fees	OL&M: \$153.42	on			Sub-Tota	\frac{\fir}{\frac{\frac{\frac{\frac{\frac{\frac{\frac{\frac{\frac{\frac{\fir}}}}}}{\frac{\frac{\frac{\frac{\frac{\frac}{\frac{\frac{\frac{\frac{\frac{\frac{\frac{\frac{\frac{\frac{\frac{\frac{\frac{\fir}}}}}}{\frac{\frac{\frac{\frac{\frac{\frac{\frac{\frac{\
OL&M Charges: Description Labor: \$0.00 Parts: \$143.00 Technicians: Miscellaneous Charges: epa fees service accessories Customer PO No:	OL&M: \$153.42 Finance Information	on act US Auth. No	39.60 Svc Ca		Sub-Tota	\$2.0 \$23.6 \$1,039.60
OL&M Charges: Description Labor: \$0.00 Parts: \$143.00 Technicians: Miscellaneous Charges: epa fees service accessories Customer PO No:	Finance Information Type: Multi-use Act Merchant No: 481 Card No: xxxxx	on cct US Auth. No 104007 xxxxxxxx3316	39.60 Svc Ca	all: \$0.00	Sub-Tota Labor: Parts: OL&M:	\$2.0 \$23.6 \$1,039.60 \$143.00 \$153.42 \$25.66
DL&M Charges: Description Labor: \$0.00 Parts: \$143.00 Technicians: Miscellaneous Charges: epa fees service accessories Customer PO No:	Finance Information Type: Multi-use Act Merchant No: 481	on ect US Auth. No 104007	39.60 Svc Ca	Svc Ac Svc Call	Labor: Parts: OL&M: cc/Enviro:	\$2.0 \$23.6 \$1,039.66 \$143.00 \$153.42 \$25.66 \$0.00
OL&M Charges: Description Labor: \$0.00 Parts: \$143.00 Technicians: Miscellaneous Charges: epa fees service accessories Customer PO No:	Finance Information Type: Multi-use Act Merchant No: 481 Card No: xxxxx Bill Code: 717	on cct US Auth. No 104007 xxxxxxxx3316	39.60 Svc Ca	Svc Ac Svc Call	Sub-Tota Labor: Parts: OL&M:	\$2.0 \$23.6 \$1,039.60 \$143.00 \$153.42 \$25.66

TERMS AND CONDITIONS

Received by:	 Date:	



Phone: 308-384-8777 Fax: 308-398-3024

Email: GrandIsland@AKRS.com

www.akrs.com



966330033020 3/27/2019 24

594668

Finance

Invoice To Account No: 121004	Deliver To:	SER	VICE INVOICE
H2 FARMS INC MARK HOLLISTER	H2 FARMS INC 11550 HILLTOP RD	Invoice Number:	966330033020
11550 HILLTOP RD	DONIPHAN NE 68832-2091	Invoice Date:	3/27/2019
DONIPHAN NE 68832-2091	2 3 1 1 1 1 1 1 1 2 3 3 3 2 3 3 1 1 1 1	Location:	24

Bus Phone: (402)845-6520

Prv Phone:

Work Order Number: Payment Type:

> Page: 1 of 2

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
MISC 1996 blue	67668	1XKNDE9X9TS720031	1XKNDE9X9TS720031G	

Gen1 Retail

Prv Phone:

Bus Phone: 402-845-6520

COMPLAINT:

01) CUSTOMER SAID ANTIFREEZE LEVEL IS LOW AND THERE'S ANTIFREEZE ON FRONT AXLE BUT CANNOT PIN POINT THE LEAK.

MARK: 390-3933

CORRECTION:

CHECKED FOR THE SOURCE OF THE ENGINE COOLANT LEAK. FOUND THE LEAK WAS BEHIND THE TURBOCHARGER & OIL COOLER. DRAINED THE COOLANT. REMOVED THE TURBOCHARGER & OIL COOLER. DISCOVERED THAT MICE HAD CHEWED INTO A HOSE THAT IS ROUTED ALONG THE BLOCK TO THE WATER FILTER. REPLACED THE HOSE, REINSTALLED THE OIL COOLER & TURBOCHARGER. NO LEAKAGE WAS VISIBLE FROM THE NEW HOSE.

Labor: \$0.00	Parts: \$46.19	OL&M: \$0.00	Svc Acc/Env:	\$579.44	Svc Call: \$0.00	Sul	o-Total:	\$625.63
TY26576	COOL-G/	ARD TM		1.00	35.99	32.39	\$32.39	N
Part Number TY26575	Description COOL-G			Quantity 1.00	<u>List Price</u> 15.00	Net Price 13.80	Extended Price \$13.80	Taxed Ind N

Technicians:

Gen2 Retail

COMPLAINT:

02) OIL LEAKS FROM THE FRONT OF THE ENGINE. WASH ENGINE TO REMOVE EXISTING DIRT & OIL. RUN ENGINE & ISOLATE THE SOURCE OF THE OIL LEAK THAT HAS BEEN DRIPPING ONTO THE FLOOR.

CORRECTION:

REMOVED THE RADIATOR, FAN, AND FRONT COVER. CLEANED THE GASKET SURFACES AND INSTALLED A NEW GASKET. REINSTALLED THE FRONT COVER. INSTALLED A NEW FRONT SEAL AND THEN REINSTALLED ALL PARTS THAT HAD BEEN REMOVED. FILLED THE ENGINE COOLING SYSTEM WITH ANTIFREEZE & THERE WAS NO VISIBLE LEAKAGE. WASHED OFF & RAN THE ENGINE & RECHECKED FOR LEAKS-OK.

Part Number 0617540	Description SEAL O RING	Quantity 2.00	<u>List Price</u> 12.93	Net Price 12.93	Extended Price \$25.86	Taxed Ind N
1182797	GASKET	1.00	4.84	4.84	\$4.84	N
1P0451	GASKET TURBO	1.00	10.65	10.65	\$10.65	N



Phone: 308-384-8777 Fax: 308-398-3024



www.akrs.com



Grand Total:

\$1,973.33

Invoice To Account No: 121004 Deliver To: SERVICE INVOICE H2 FARMS INC H2 FARMS INC Invoice Number: 966330033020 MARK HOLLISTER 11550 HILLTOP RD Invoice Date: 3/27/2019 11550 HILLTOP RD **DONIPHAN NE 68832-2091** DONIPHAN NE 68832-2091 Location: 24 Work Order Number: 594668 Payment Type: Finance Bus Phone: 402-845-6520 Bus Phone: (402)845-6520 Prv Phone: Prv Phone: 2 of 2 Page: Make/Model: Meter: Serial Number: Eq ID: Fleet No: MISC 1996 blue 67668 1XKNDE9X9TS720031 1XKNDE9X9TS720031G Gen2 Retail 3193486 FT STRUCTURE GSK KIT 1.00 362.87 362.87 \$362.87 Ν GT3230-3/8 HOSE 3230-029 4.00 6.05 6.05 \$24.20 N Labor: \$0.00 Parts: \$428.42 OL&M: \$0.00 Svc Acc/Env: \$878.63 Svc Call: \$0.00 Sub-Total: \$1,307.05 Technicians: **INVOICE CONTAINS \$4.80 DISCOUNT** Miscellaneous Charges: epa fees \$2.00 service accessories \$38.65 **Finance Information** Labor: \$1,458.07 Customer PO No: Type: Multi-use Acct US Auth. No: 730118 Parts: \$474.61 Tax Exempt No: FORM 13 Merchant No: 48104007 OL&M: \$0.00 Card No: xxxxxxxxxxxx3316 Svc Acc/Enviro: \$40.65 - SHOP WORK TRUCK Bill Code: 104 Svc Call/Hauling: \$0.00 Credit Plan: 249 - PURCHASE Sales Tax: \$0.00 * * * DOCUMENT COPY * * *

TERMS AND CONDITIONS

Described by	D 1
Received by:	Date:



Phone: 308-384-8777 Fax: 308-398-3024

Email: GrandIsland@AKRS.com

www.akrs.com



Invoice To Account No: 121004

Deliver To:

SERVICE INVOICE

H2 FARMS INC MARK HOLLISTER 11550 HILLTOP RD DONIPHAN NE 68832-2091

Bus Phone: 402-845-6520

H2 FARMS INC 11550 HILLTOP RD **DONIPHAN NE 68832-2091**

Invoice Number: Invoice Date: 818794033020

Location:

11/8/2017

Work Order Number:

24

574304

Payment Type:

Finance

Bus Phone: (402)845-6520

Prv Phone:

Page:

1 of 2

Prv Phone: Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

MISC 1996 blue

425119

1XKNDE9X9TS720031

1XKNDE9X9TS720031G

Gen1 Retail

COMPLAINT:

SERVICE CALL: ENGINE STARTED RUNNING ROUGH, THEN DIED. CUSTOMER RESTARTED ENGINE BUT COULDN'T KEEP IT RUNNING. NOW IT WON'T START AT ALL. SOMEONE TOLD CUSTOMER THE FUEL PUMP WAS BAD; HE'S WANTING TO VERIFY THIS BEFORE ORDERING FUEL PUMP FROM CAT.

CALL MARK MONDAY MORNING FOR DIRECTIONS TO TRUCK: 390-3933


CORRECTION:

DROVE TO THE RED KENWORTH TRUCK. REMOVED FUEL FILTER AND INSTALLED NEW ONE. COULD NOT GET ANY FUEL. TOOK LINE OFF FILTER BASE, CRANKED THE ENGINE & THERE WAS NOT FUEL OUT OF THE LINE. MADE SURE THAT THE FUEL SUPPLY LINES WERE OPEN. REMOVED THE FUEL TRANSFER PUMP, DROVE TO THE CAT DEALER &ACQUIRED A NEW PUMP. AFTER INSTALLING THE PUMP STILL DID NOT GET ANY FUEL OUT OF THE FILTER. REMOVED THE HAND PRIMER PUMP & FOUND IT HAD A FAILED CHECK VALVE. GOT A PRIMER PUMP FROM CAT & INSTALLED IT. OPERATED THE PRIMER PUMP UNTIL THE AIR WAS BLED FROM THE FUEL FILTER. DISCONNECTED THE LINE TO THE INJECTION PUMP & PURGED THE AIR FROM THE FUEL SYSTEM. TIGHTENED THE LINE FITTING. BLED AIR FROM THE INJECTION PUMP. THE BATTERIES WERE TOO WEAK TO CRANK THE ENGINE FAST ENOUGH TO GET IT TO START. JUMPER CABLES WERE BROUGHT TO THE TRUCK - NO CHARGE TO CUSTOMER. CONNECTED THE JUMPER CABLES & CHARGED THE BATTERIES. THE ENGINE CRANKED OK BUT WOULD NOT START. TRIED LOOSENING THE HIGH PRESSURE FUEL LINE NUTS AT THE ENGINE TO BLEED AIR FROM THEM. THE TECHNICIAN COULD NOT GET THE LINE NUTS TO MOVE. TRIED STARTING THE ENGINE BUT THE HIGH PRESSURE FUEL LINES SEEMED TO B AIR LOCKED & PREVENTING DIESEL FROM REACHING THE INJECTION NOZZLES. RETURNED TO THE SERVICE DEPARTMENT FOR SOME STARTING FLUID & A SECOND TECHNICIAN TO HELP WITH GETTING THE ENGINE STARTED. THE SECOND TECHNICIAN OPERATED THE SWITCH TO CRANK THE ENGINE WHILE THE SECOND SPRAYED STARTING FLUID, IN A CONTROLLED LIMITED MANNER INTO THE AIR INTAKE. THE ENGINE RAN ON STARTING FLUID FOR A FEW SECONDS & THEN DIESEL. AFTER GETTING THE AIR PURGED FROM THE HIGH PRESSURE FUEL LINES, THE ENGINE RAN OK ON DIESEL. AS PER CONVERSATION WITH MARK. THE ENGINE WAS LEFT RUNNING. TALKED TO MARK AND HE SAID TO LEAVE IT RUNNING AND HE WOULD COME AND GET IT. DROVE BACK TO SHOP.

Part Number 0R3008	Description PUMP G	<u>Quantity</u> 1.00	<u>List Price</u> 516.06	Net Price 516.06	Extended Price \$516.06	Taxed Ind N
0S1615	CAP SCREW	1.00	0.28	0.28	\$0.28	N
1052508	PUMP AS	1.00	154.83	154.83	\$154.83	N
1P0436	GASKET	1.00	2.10	2.10	\$2.10	N
4J8997	SEAL O RING	1.00	2.86	2.86	\$2.86	N
BF7587	FILTER	1.00	26.25	26.25	\$26.25	N



Phone: 308-384-8777 Fax: 308-398-3024

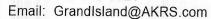

www.akrs.com



Invoice To Account No: 121004 SERVICE INVOICE Deliver To: H2 FARMS INC H2 FARMS INC Invoice Number: 818794033020 MARK HOLLISTER 11550 HILLTOP RD Invoice Date: 11/8/2017 11550 HILLTOP RD DONIPHAN NE 68832-2091 Location: **DONIPHAN NE 68832-2091** 24 Work Order Number: 574304 Payment Type: Finance Bus Phone: 402-845-6520 Bus Phone: (402)845-6520 Prv Phone: Prv Phone: Page: 2 of 2 Make/Model: Meter: Serial Number: Eq ID: Fleet No: MISC 1996 blue 425119 1XKNDE9X9TS720031 1XKNDE9X9TS720031G Gen1 Retail RE556468 7 OZ STARTING FLUID 1.00 4.40 4.40 \$4.40 N Labor: \$0.00 Parts: \$706.78 OL&M: \$0.00 Svc Acc/Env: \$892.10 Svc Call: \$0.00 Sub-Total: \$1,598.88 Technicians: ATTENTION: Part(s) values for this invoice have changed. Original Invoice Parts Sale Value = \$823.78 Miscellaneous Charges: epa fees \$2.00 service accessories \$34.32 Finance Information Labor: \$892.10 Customer PO No: Type: Multi-use Acct US Auth. No: 746765 \$823.78 Parts: Tax Exempt No: FORM 13 Merchant No: 48104007 OL&M: \$0.00 Card No: xxxxxxxxxxxx3316 Svc Acc/Enviro: \$36.32 Bill Code: 344 - SERVICE CALL/TRUCK Svc Call/Hauling: \$0.00 Sales Tax: \$0.00 Credit Plan: 249 - PURCHASE * * * DOCUMENT COPY * * * **Grand Total:** \$1,752.20

TERMS AND CONDITIONS

		_	
Pacaivad hv		Data.	
Necelved by.	 	Date.	



Phone: 308-384-8777 Fax: 308-398-3024

Email: GrandIsland@AKRS.com

www.akrs.com



Invoice to Account No. 121004	Deliver to:	SER	SERVICE INVOICE		
H2 FARMS INC MARK HOLLISTER	H2 FARMS INC 11550 HILLTOP RD	Invoice Number:	477035033020		
11550 HILLTOP RD	DONIPHAN NE 68832-2091	Invoice Date:	10/27/2014		
DONIPHAN NE 68832-2091		Location:	24		
		Work Order Number:	522019		
		Payment Type:	Finance		
Bus Phone: 402-845-6520	Bus Phone: (402)845-6520				
Prv Phone:	Prv Phone:	Page:	1 of 5		

 Make/Model:
 Meter:
 Serial Number:
 Eq ID:
 Fleet No:

 MISC 1996 blue
 56226
 1XKNDE9X9TS720031
 1XKNDE9X9TS720031GI

DOT -F-0000009 Retail

Invoice To Account No: 121004

COMPLAINT:

DOT INSPECTION - TRUCK & TRAILER

MARK: 390-3933

Technician Comments: WHENT OVER INSECTION WITH MARK AFTER IT WAS DONE. ALSO REPLACED ON LIGHT ON THE BACK OF THE TRAILOR. THE LEFT MIDDLE MARKEER LIGHT.

CORRECTION:

DOT INSPECTION - TRUCK & TRAILER

Technician Comments: WHENT OVER INSECTION WITH MARK.

ALSO REPLACED THE LEFT CENTER MARKER LIGHT ON LIGHT ON THE BACK OF THE SEMI GRAIN TRAILER.

Labor: \$0.00 Parts: \$0.00 OL&M: \$0.00 Svc Acc/Env: \$111.27 Svc Call: \$0.00 Sub-Total: \$111.27

Technicians:

GEN2 Retail COMPLAINT: SERVICE TRUCK

USE ROTELLA-T 15-40 OIL

Technician Comments: DRAINED THE OIL AND REMOVED THE FILTER AND INSTALLED A NEW ONE. REMOVED THE FUEL FILTER, AND WATER FILTERS AND INSTALLED NEW ONES, FILLED ENGINGE BACK UP WITH OIL, GEASED ALL ZERKS AND CHECKED THE OIL LEVELS IN REAR ENDS AND TRANSMISSION.

CORRECTION:



Phone: 308-384-8777 Fax: 308-398-3024



www.akrs.com



Invoice To Account No: 121004

Deliver To:

SERVICE INVOICE

H2 FARMS INC MARK HOLLISTER 11550 HILLTOP RD DONIPHAN NE 68832-2091

H2 FARMS INC 11550 HILLTOP RD DONIPHAN NE 68832-2091

Invoice Number: Invoice Date:

477035033020

Location:

10/27/2014 24

Work Order Number:

522019

Payment Type:

Finance

Bus Phone: 402-845-6520

Prv Phone:

Bus Phone: (402)845-6520

Prv Phone:

Page:

2 of 5

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

MISC 1996 blue

56226

1XKNDE9X9TS720031

1XKNDE9X9TS720031G

GEN2 Retail

SERVICE TRUCK

USE ROTELLA-T 15W-40 OIL

Technician Comments:

CHANGED ENGINE OIL & FILTER - FILLED ENGINE TO OPIATING LEVEL WITH NEW ROTELLA 15W-40 OIL

CHANGED FUEL & WATER SEPARATOR FILTERS. BLED AIR FROM FUEL SYSTEM, STARTED ENGINE & CHECKED FOR LEAKS.

GREASED ALL GREASE FITTINGS.

CHECKED OIL LEVEL IN AXLE DIFFERENTIAL HOUSINGS & TRANSMISSION.

Labor: \$0.00	Parts: \$360.94	OL&M: \$0.00	Svc Acc/Env:	\$120.17	Svc Call: \$0.00	Suk	o-Total:	\$481.11
SLO-550019913				12.00	25.73	25.73	\$308.76	Υ
DN-P554071				1.00	13.55	13.55	\$13.55	Υ
DN-P554005				1.00	21.25	21.25	\$21.25	Υ
Part Number DN-P551311	Description			Quantity 1.00	List Price 17.38	<u>Net Price</u> 17.38	Extended Price \$17.38	Taxed Ind Y

Technicians:

GEN3 Retail

COMPLAINT:

FIX SPEEDOMETER

Technician Comments: CHECKED OUT THE WIRE HARNESS REMOVED THE SPEED SENSOR TO MAKE SURE IT WAS OK AND ALL SO MADE SURE THE RING THE SENSOR RUN NEXT TO INSIDE THE TRANSMISSION WAS TIGHT AND NOT SLIPPING ON THE OUTPUT SHAFT. REINSTALLED THE SENSOR AND AJUSTED IT SO IT HAD THE RINT CLEARANCE BETWEEN IT AND THE RING. DROVE TRUCK AND THE SPEEDOMET SEEMED TO WORK OK.

CORRECTION:

\$481.11



Phone: 308-384-8777 Fax: 308-398-3024



www.akrs.com



SERVICE INVOICE

invoice	To Account	No:	121004

H2 FARMS INC MARK HOLLISTER

11550 HILLTOP RD

DONIPHAN NE 68832-2091

Bus Phone: 402-845-6520

Deliver To:

H2 FARMS INC 11550 HILLTOP RD

DONIPHAN NE 68832-2091

Invoice Number: Invoice Date: 477035033020 10/27/2014

Location:

24

Work Order Number:

Payment Type:

522019 Finance

Bus Phone: (402)845-6520

Prv Phone:

Page:

3 of 5

Prv Phone: Make/Model:

Meter:

Serial Number:

Eq ID

Fleet No:

MISC 1996 blue

56226

1XKNDE9X9TS720031

1XKNDE9X9TS720031GI

GEN3 Retail

Technician Comments:

CHECKED OUT THE WIRE HARNESS. REMOVED THE SPEED SENSOR TO CHECK IT. CHECKED THE TONE WHEEL THAT THE SENSOR DETERMINES SPEED OFF OF. SENSING RING WAS TIGHT ON THE TRANSMISSION OUTPUT SHAFT. REINSTALLED THE SENSOR AND ADJUSTED IT SO IT HAD THE CORRECT CLEARANCE BETWEEN IT AND THE RING. DROVE TRUCK AND THE SPEEDOMETER APPEARED TO BE WORKING O.K.

Labor: \$0.00

Parts: \$0.00

OL&M: \$0.00

Svc Acc/Env: \$161.69

Svc Call: \$0.00

Sub-Total:

\$161.69

Technicians:

GEN4 Retail

COMPLAINT: REPAIR OIL LEAK ON ENGINE

Technician Comments: UNHOOKE LIGHTS AND REMOVED THE HOOD. DRAINED THE RADIATOR, REMOVED THE FUEL COOLER, THE A/C CONDENSOR AND THEN THE RADIATOR. REMOVED THE FAN, ALTERNATOR, IDLER, A/C BRACKET, FRONT PULLEY AND BALANCER AND THEN THE FRONT COVER, CLEANED UP THE COVER AND THE BLOCK INSTALLED A NEW GASKET AND INSTALLED THE FRONT COVER, INSTALLED A NEW SEAL AND THEN REINSTALLED ALL PARTS THAT HAD BEEN REMOVED IN THE TEAR DOWN, FILLED BACK UP WITH COOLANT AND RUN ENGINGE CHECKED FOR LEAKS SEEN NONE. INSTALLED THE HOOD AND HOOKED UP THE LIGHTS.

CORRECTION:


REPAIR OIL LEAK ON ENGINE. OIL IS LEAKING FROM THE ENGINE TIMING GEAR COVER & FRONT CRANKSHAFT OIL SEAL.

Technician Comments:

UNHOOKED LIGHTS AND REMOVED THE HOOD. DRAINED THE RADIATOR, REMOVED THE FUEL COOLER, THE A/C CONDENSER AND THEN THE RADIATOR. REMOVED THE FAN, ALTERNATOR, IDLER, A/C BRACKET, FRONT PULLEY AND BALANCER. REMOVED THE TIMING GEAR COVER FROM THE ENGINE. CLEANED THE COVER & MATING GASKET SURFACES ON THE ENGINE BLOCK. INSTALLED A NEW GASKET AND INSTALLED THE TIMING GEAR COVER. INSTALLED A NEW FRONT CRANKSHAFT OIL SEAL. REASSEMBLED COMPONENTS. FILLED ENGINE COOLING SYSTEM WITH ANTIFREEZE. STARTED THE ENGINE & CHECKED FOR LEAKS. NO LEAKAGE WAS SEEN. REINSTALLED THE HOOD & CONNECTED WIRING TO THE LIGHTS. CHECKED OPERATION OF THE LIGHTS. DROVE THE TRUCK & RECHECKED FOR LEAKS ON ENGINE.



Phone: 308-384-8777 Fax: 308-398-3024

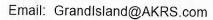

www.akrs.com



Invoice To Account No: 121004

Deliver To:

SERVICE INVOICE

Fleet No:

Sub-Total:

H2 FARMS INC MARK HOLLISTER 11550 HILLTOP RD

H2 FARMS INC 11550 HILLTOP RD

Invoice Number: Invoice Date:

477035033020

DONIPHAN NE 68832-2091

DONIPHAN NE 68832-2091

10/27/2014

Location: Work Order Number:

24

Payment Type:

522019 Finance

Bus Phone: 402-845-6520

Bus Phone: (402)845-6520

Page:

4 of 5

Prv Phone:

Prv Phone:

OL&M: \$0.00

Serial Number:

Eq ID:

\$1,663.33

Make/Model: MISC 1996 blue

Meter: 56226

1XKNDE9X9TS720031

Svc Acc/Env: \$1,198.56 Svc Call: \$0.00

1XKNDE9X9TS720031GI

GEN4 Retail

<u>Part Number</u> 1260110	<u>Description</u>	Quantity 1.00	List Price 45.10	Net Price 45.10	Extended Price \$45.10	Taxed Ind Y
14H605	Nut	2.00	0.20	0.20	\$0.40	Υ
17540		1.00	24.73	24.73	\$24.73	Υ
1900649		1.00	279.36	279.36	\$279.36	Υ
21M7216	SCREW	2.00	0.40	0.40	\$0.80	Υ
25080680		1.00	70.73	70.73	\$70.73	Υ
3H0976		1.00	14.75	14.75	\$14.75	Υ
9Y3590		1.00	18.90	18.90	\$18.90	Υ
BRZ-CT-350-L-SS		1.00	10.00	10.00	\$10.00	Υ

Labor: \$0.00 Technicians:

GEN5 Retail COMPLAINT: WASH ENGINE

CORRECTION:

WASHED OIL & DIRT FROM THE ENGINE.

Parts: \$464.77

CONTINUED ON NEXT PAGE->



Phone: 308-384-8777 Fax: 308-398-3024



www.akrs.com



Sales Tax:

Grand Total:

Svc Acc/Enviro:

Svc Call/Hauling:

\$51.24

\$0.00

\$57.81

\$2,570.95

Invoice To Account No: 121004	Deliver To:		S	ERVICE I	NVOICE
H2 FARMS INC	H2 FARMS INC		Invoice Number:		7035033020
MARK HOLLISTER 11550 HILLTOP RD	11550 HILLTOP RD		Invoice Date:		10/27/2014
DONIPHAN NE 68832-2091	DONIPHAN NE 68832-2091		Location:		24
			Work Order Number:		522019
			Payment Type:		Finance
Bus Phone: 402-845-6520	Bus Phone: (402)8	45-6520			
Prv Phone:	Prv Phone:		Page:		5 of 5
Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet	No:
MISC 1996 blue	56226	1XKNDE9X9TS720031	1XKNDE9X9TS72	003161	
GEN5 Retail	33220	1,444,825,616,726651	17((1))2(3)(3)(3)(2)	0031G	
GEN5 Retail Labor: \$0.00 Parts: \$0.00	OL&M: \$0.00	Svc Acc/Env: \$44.50	Svc Call: \$0.00	Sub-Total:	\$44.50
Labor: \$0.00 Parts: \$0.00					\$44.50
Labor: \$0.00 Parts: \$0.00 Technicians:					\$44.50
Labor: \$0.00 Parts: \$0.00					
Labor: \$0.00 Parts: \$0.00 Technicians: Miscellaneous Charges:					\$44.50 \$49.24 \$2.00
Labor: \$0.00 Parts: \$0.00 Technicians: Miscellaneous Charges: service accessories		Svc Acc/Env: \$44.50		Sub-Total:	\$49.24 \$2.00
Labor: \$0.00 Parts: \$0.00 Technicians: Miscellaneous Charges: service accessories	OL&M: \$0.00	Svc Acc/Env: \$44.50	Svc Call: \$0.00		\$49.24

xxxxxxxxxxxx3316

- PARTS

- PURCHASE

120

TERMS AND CONDITIONS

* * * DOCUMENT COPY * * *

Repayment Terms:

This purchase(s) is subject to the terms of the multi-use account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

Received by:	Date:
--------------	-------

Card No:

Bill Code:

Credit Plan: 249